

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
-------------------	----------------------	-------------	-----------------------	-------------------	----------------------------	-----	--------------	--------------	---------------	----	--------------

Total Cost for Priority: A = \$256,487

Priority: A Greenville PUBLIC RIGHT-OF-WAY Site Cost = \$256,487

3 204 Main St \$588

Hazards/Protruding Objects

Hazardous drop-off adjacent to walk way (not required between walks or sidewalks & adjacent streets or driveway; or if guard or handrail is provided with guide rail centered 2-4" above walk).	No abrupt changes in level >4" vertical (planters, fountains, ponds), 6" min. curb above the potential drop off (CA only)	Raised sidewalk has a 12" high curb.	ADAAG: N.A. T24: 1133B.8.2 CHECK	Install a protective rail.	21	LF	28	\$588	A
---	---	--------------------------------------	---	----------------------------	----	----	----	-------	---

4 207 Main St \$2,352

Walks and Sidewalks

Smooth surface, no excessive irregular surfaces.	Yes.	Sidewalk has multiple dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	168	SF	14	\$2,352	A
--	------	-------------------------------------	------------------------------------	--	-----	----	----	---------	---

5 208 Main St \$140

Walks and Sidewalks

Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").	Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	4	LF	35	\$140	A
--	--	--------------------------	------------------------------------	--	---	----	----	-------	---

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
6 220 Main St									\$934		

Hazards/Protruding Objects

Hazardous drop-off adjacent to walk way (not required between walks or sidewalks & adjacent streets or driveway; or if guard or handrail is provided with guide rail centered 2-4" above walk).	No abrupt changes in level >4" vertical (planters, fountains, ponds), 6" min. curb above the potential drop off (CA only)		Sidewalk curb ranges from 8" - 15" high.	ADAAG: N.A. T24: 1133B.8.2 CHECK	Install a protective rail.	28	LF	28	\$784	A	
---	---	--	--	--	----------------------------	----	----	----	-------	---	--

Walks and Sidewalks

Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a 4" crack.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	3	SF	50	\$150	A	
--	------	--	--------------------------	--------------------------------	---	---	----	----	-------	---	--

7 213 Main St									\$7,546		
----------------------	--	--	--	--	--	--	--	--	----------------	--	--

Walks and Sidewalks

Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	140	SF	14	\$1,960	A	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	399	SF	14	\$5,586	A	

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
8 224 Main St									\$962		

Hazards/Protruding Objects

Hazardous drop-off adjacent to walk way (not required between walks or sidewalks & adjacent streets or driveway; or if guard or handrail is provided with guide rail centered 2-4" above walk).	No abrupt changes in level >4" vertical (planters, fountains, ponds), 6" min. curb above the potential drop off (CA only)		Raised sidewalk has a 15" high curb. Photo #: 3	ADAAG: N.A. T24: 1133B.8.2 CHECK	Install a protective rail.	29	LF	28	\$812	A	
---	---	--	--	---	----------------------------	----	----	----	-------	---	--

Walks and Sidewalks

Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	
---	--	--	--------------------------	--------------------------------	----------------------	---	-----	-----	-------	---	--

10 300 Main St									\$300		
-----------------------	--	--	--	--	--	--	--	--	--------------	--	--

Walks and Sidewalks

Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	
---	--	--	--------------------------	--------------------------------	----------------------	---	-----	-----	-------	---	--

Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 2" dip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise drain inlet.	1	JOB	150	\$150	A	
---	--	--	------------------------	--------------------------------	--------------------	---	-----	-----	-------	---	--

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
11 301 Main St									\$1,156		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a broken curb. Photo #: 7	ADAAG: 4.5.2 T24: 1133B.7.1	Replace broken curb.	29	LF	14	\$406	A	
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	5	SF	150	\$750	A	
12 305 Main St									\$854		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	10	LF	35	\$350	A	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a broken curb.	ADAAG: 4.5.2 T24: 1133B.7.1	Replace broken curb.	36	LF	14	\$504	A	
14 307 Main St									\$665		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a broken curb.	ADAAG: 4.5.2 T24: 1133B.7.1	Replace broken curb.	35	LF	14	\$490	A	

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
16 314 Main St									\$2,688		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	192	SF	14	\$2,688	A	
18 317 Main St									\$7,644		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	506	SF	14	\$7,084	A	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a broken curb.	ADAAG: 4.5.2 T24: 1133B.7.1	Replace broken curb.	40	LF	14	\$560	A	
20 333 Main St									\$10,468		
Ramps and Exit Facilities											
Ramp needed to be used as entrance/exits to a facility located in the path of travel.	Any route of travel with slope greater than 1:20 (5%).		Ramp (5') does not have the required handrails.	ADAAG: 4.1.2 (1) (2) & 4.8 T24: 1133B.5.1	Provide new 48" wide concrete ramp with handrails and extensions at both sides of ramp.	16	LF	250	\$4,000	A	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	462	SF	14	\$6,468	A	

PRIORITY: A

28-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
21 341 Main St									\$8,120		

Hazards/Protruding Objects

Hazardous drop-off adjacent to walk way (not required between walks or sidewalks & adjacent streets or driveway; or if guard or handrail is provided with guide rail centered 2-4" above walk).	No abrupt changes in level >4" vertical (planters, fountains, ponds), 6" min. curb above the potential drop off (CA only)	Raised sidewalk has a 15" high curb. Photo #: 5	ADAAG: N.A. T24: 1133B.8.2 CHECK	Install a protective rail.	40	LF	28	\$1,120	A
---	---	--	--	----------------------------	----	----	----	---------	---

Walks and Sidewalks

Accessible path of travel to connect accessible buildings, facilities, elements or spaces on the same site.	Yes	There is not an accessible route of travel to the sidewalk with a high curb, due to the location of corner stairs. Photo #: 6	ADAAG: 4.3.2 or 4.1.2 (1) T24: 1114B.1.2	Provide a new ramp in front of the post adjacent to the street, block stair with a protective rail at the corner. Recommended protective rails for these sidewalks are under other item number in the report.	1	JOB	7,000	\$7,000	A
---	-----	--	---	---	---	-----	-------	---------	---

22 380 Main St									\$1,540		
-----------------------	--	--	--	--	--	--	--	--	----------------	--	--

Hazards/Protruding Objects

Hazardous drop-off adjacent to walk way (not required between walks or sidewalks & adjacent streets or driveway; or if guard or handrail is provided with guide rail centered 2-4" above walk).	No abrupt changes in level >4" vertical (planters, fountains, ponds), 6" min. curb above the potential drop off (CA only)	Sidewalk curb ranges from 11" - 18" high.	ADAAG: N.A. T24: 1133B.8.2 CHECK	Install a protective rail.	55	LF	28	\$1,540	A
---	---	---	--	----------------------------	----	----	----	---------	---

PRIORITY: A

28-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
23 400 Main St									\$3,500		

Exterior Routes of Travel

Accessible route to building entrances & exterior ground level exits.	Yes		Sidewalk does not have an accessible route of travel, due to the location of stairs. (98 SF) Photo #: 4	ADAAG: 4.3.2 T24: 1007.1, 1127B.1	Provide a new ramp with the required handrails.	1	JOB	3,500	\$3,500	A	
---	-----	--	--	--	---	---	-----	-------	---------	---	--

24 401 Main St									\$3,360		
-----------------------	--	--	--	--	--	--	--	--	----------------	--	--

Walks and Sidewalks

Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple dislocations and	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	240	SF	14	\$3,360	A	
--	------	--	--	------------------------------------	--	-----	----	----	---------	---	--

26 410 Main St									\$3,500		
-----------------------	--	--	--	--	--	--	--	--	----------------	--	--

Walks and Sidewalks

Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	250	SF	14	\$3,500	A	
--	------	--	-------------------------------------	------------------------------------	--	-----	----	----	---------	---	--

28 419 Main St									\$150		
-----------------------	--	--	--	--	--	--	--	--	--------------	--	--

Walks and Sidewalks

Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Lower utility cover.	1	JOB	150	\$150	A	
---	--	--	--------------------------	--------------------------------	----------------------	---	-----	-----	-------	---	--

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
29 421 Main St									\$280		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	4	LF	35	\$140	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	4	LF	35	\$140	A	
30 423 Main St									\$2,520		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	180	SF	14	\$2,520	A	
32 429 Main St									\$140		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	4	LF	35	\$140	A	
33 430 Main St									\$300		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		54" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	300	\$300	A	

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
34 435 Main St									\$1,148		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	72	SF	14	\$1,008	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	4	LF	35	\$140	A	
37 441 Main St									\$784		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	4	LF	35	\$140	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	4	LF	35	\$140	A	
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	36	SF	14	\$504	A	
41 522 Main St									\$300		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		60" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	300	\$300	A	

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
43 536 Main St									\$250		
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is 24" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Trim vegetation to provide the required sidewalk width.	1	JOB	250	\$250	A	
46 200 Mill St									\$900		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" dip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	
Pavement dislocations, changes in level - due to the drop of Red Brick Stamp.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 3/4" low area adjacent to the brick border.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace, repair or raise Red Brick Stamp surface area as needed to correct abrupt change in level.	50	LF	15	\$750	A	
47 115 Pine St									\$1,680		
Hazards/Protruding Objects											
Hazardous drop-off adjacent to walk way (not required between walks or sidewalks & adjacent streets or driveway; or if guard or handrail is provided with guide rail centered 2-4" above walk).	No abrupt changes in level >4" vertical (planters, fountains, ponds), 6" min. curb above the potential drop off (CA only)		Raised sidewalk has a 20" high curb.	ADAAG: N.A. T24: 1133B.8.2 CHECK	Install a protective rail.	60	LF	28	\$1,680	A	

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
50 100 Pine St									\$4,214		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple dislocations and cracks.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	301	SF	14	\$4,214	A	
52 204 Pine St									\$3,920		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple dislocations and cracks.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	280	SF	14	\$3,920	A	
53 206 Pine St									\$175		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A	
54 101 Bidwell St									\$150		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	
55 101 Bush St									\$2,336		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.9% - 4.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	292	SF	8	\$2,336	A	

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
56 111 Bush St									\$1,856		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope ranges from 2.7% - 3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	92	SF	8	\$736	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 4.0% - 4.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	140	SF	8	\$1,120	A	
57 115 Bush St									\$3,972		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp cross slope is 3%, it does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	A	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.7% - 4.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	184	SF	8	\$1,472	A	

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
58 201 Bush St									\$4,300		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp running slope is 10.6%, no top landing provided, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	A	
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with		Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800	A	

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
59 301 Bush St									\$5,360		
Walks and Sidewalks											
Width exception: when because of right-of way restrictions, natural barriers or other existing conditions, the enforcing agency determines that compliance with the 48" (CA only) clear sidewalk width would create an unreasonable hardship.	Clear width may be reduced to 36" min. (ADA only)		Sidewalk is only 36" wide to the location of utility pole, instead of the required 48" minimum. Unreasonable hardship could be applied. Utility pole could be relocated when altering the area.	ADAAG: N.A. T24: 1133B.7.1.3 Exception	Due to unreasonable hardship, leave existing sidewalk as is (36" and over 36" wide).		REF.	0		A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	320	SF	8	\$2,560	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 2.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	250	SF	8	\$2,000	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.8% - 3.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	100	SF	8	\$800	A	
60 305 Bush St									\$3,480		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 3.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	435	SF	8	\$3,480	A	

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
61 319 Bush St									\$2,960		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	370	SF	8	\$2,960	A	
62 329 Bush St									\$3,200		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has uneven surfaces due to the location of underdrain.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	20	SF	8	\$160	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has uneven surfaces due to the location of underdrain.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	20	SF	8	\$160	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	360	SF	8	\$2,880	A	

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
63 335 Bush St									\$3,045		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" dislocation.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" dislocation.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	100	SF	14	\$1,400	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" dislocation.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.4% - 3.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	140	SF	8	\$1,120	A	

PRIORITY: A

28-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
64 205 Grand St									\$152,400		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	A	
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	A	
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		66" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	488	SF	300	\$146,400	A	

PRIORITY: A

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
65 224 Grand St									\$350		

Walks and Sidewalks

Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" dislocation.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" dislocation.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A	

PRIORITY: B

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
-------------------	----------------------	-------------	-----------------------	-------------------	----------------------------	-----	--------------	--------------	---------------	----	--------------

Total Cost for Priority: B = \$15,424

Priority: B

Greenville PUBLIC RIGHT-OF-WAY Site Cost = \$15,424

3 204 Main St

\$2,000

Curb Ramps & Landings

Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None. Photo #: 1	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	B	
--	-----	--	---------------------	--------------------------------	--	---	-----	------	---------	---	--

8 224 Main St

\$8

Walks and Sidewalks

Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of sign.	ADAAG: 4.3.3 T24: 1133B.7.1	Move sign.	1	JOB	8	\$8	B	
----------------------	-----------------------------	--	---	--------------------------------	------------	---	-----	---	-----	---	--

10 300 Main St

\$250

Walks and Sidewalks

Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of furniture.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Relocate newspaper/magazine vending stands, mailbox or other sidewalk furniture to provide required clear path of travel.	1	JOB	250	\$250	B	
---	-----------------------------	--	--	---	---	---	-----	-----	-------	---	--

PRIORITY: B

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
29 421 Main St									\$250		
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is 40" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Trim vegetation to provide the required sidewalk width.	1	JOB	250	\$250	B	
35 438 Main St									\$250		
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Trim vegetation to provide the required sidewalk width.	1	JOB	250	\$250	B	
42 528 Main St									\$250		
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is 38" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Trim vegetation to provide the required sidewalk width.	1	JOB	250	\$250	B	

PRIORITY: B

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
50 100 Pine St									\$2,000		

Curb Ramps & Landings

Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	B	
--	-----	--	-------	--------------------------------	--	---	-----	------	---------	---	--

51 202 Pine St									\$2,000		
-----------------------	--	--	--	--	--	--	--	--	----------------	--	--

Curb Ramps & Landings

Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	B	
--	-----	--	-------	--------------------------------	--	---	-----	------	---------	---	--

PRIORITY: B

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
53 206 Pine St									\$4,520		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	B	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk is cracked.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	180	SF	14	\$2,520	B	

PRIORITY: B

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
54 101 Bidwell St									\$3,896		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	B	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple cracks.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	4	SF	50	\$200	B	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.0% - 4.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	212	SF	8	\$1,696	B	

PRIORITY: C

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
----------------	-------------------	-------------	--------------------	----------------	-------------------------	-----	-----------	-----------	------------	----	-----------

Total Cost for Priority: C = \$86,895

Priority: C

Greenville PUBLIC RIGHT-OF-WAY Site Cost = \$86,895

2 201 Main St

\$8,370

Curb Ramps & Landings

Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
--	-----	--	-------	--------------------------------	--	---	-----	------	---------	---	--

Walks and Sidewalks

Smooth surface, no excessive irregular surfaces.	Yes.		Uneven surfaces due to spaulding in sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	455	SF	14	\$6,370	C	
--	------	--	---	--------------------------------	--	-----	----	----	---------	---	--

3 204 Main St

\$696

Walks and Sidewalks

Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	39	SF	8	\$312	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.6% - 4.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	48	SF	8	\$384	C	

PRIORITY: C

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
4 207 Main St									\$1,760		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	220	SF	8	\$1,760	C	
6 220 Main St									\$2,856		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete. Photo #: 2	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	4	SF	14	\$56	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	350	SF	8	\$2,800	C	

PRIORITY: C

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
8 224 Main St									\$2,794		
Curb Ramps & Landings											
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with		Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800	C	
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is 38" wide due to the location of furniture.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Relocate newspaper/magazine vending stands, mailbox or other sidewalk furniture to provide required clear path of travel.	1	JOB	250	\$250	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.8% - 3.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	218	SF	8	\$1,744	C	

PRIORITY: C

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
9 225 Main St									\$5,688		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	C	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 4.0% - 5.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	336	SF	8	\$2,688	C	
10 300 Main St									\$1,760		
Curb Ramps & Landings											
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with		Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800	C	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.4% - 5.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	120	SF	8	\$960	C	

PRIORITY: C

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
11 301 Main St									\$2,500		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp has a lip, no top or bottom landing, it does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	C	
13 306 Main St									\$1,512		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.7% - 6.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	189	SF	8	\$1,512	C	
15 310 Main St									\$100		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk is cracked.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	1	JOB	50	\$50	C	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk is cracked.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	1	JOB	50	\$50	C	
16 314 Main St									\$1,456		
Walks and Sidewalks											
Surface stable, firm, slip resistant.	Surfaces with <6% gradient shall have a medium salted finish.		There is no compliant driveway.	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a new driveway.	182	SF	8	\$1,456	C	

PRIORITY: C

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
17 316 Main St									\$2,000		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
18 317 Main St									\$3,500		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp flare is 10.6%, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C	
19 325 Main St									\$2,464		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 2.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	308	SF	8	\$2,464	C	

PRIORITY: C

28-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
22 380 Main St									\$2,500		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp does not have a top or bottom landing, it does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	C	

23 400 Main St									\$3,528		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Uneven surfaces due to spaulding concrete in sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	252	SF	14	\$3,528	C	

PRIORITY: C

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
24 401 Main St									\$9,360		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp does not have top landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	C	
Detectable Warnings/Truncated Domes											
Where walk crosses or adjoins vehicular way not separated by curb, guard or handrails.	Yes		Sidewalk does not have a curb, blended condition does not provide cane detectability for blind pedestrians.	ADAAG: 4.3.2 T24: 1133B.8.5	Modify existing street as needed to provide a 6" high curb that is cane detectable by blind pedestrians.	84	LF	65	\$5,460	C	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 2.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	175	SF	8	\$1,400	C	

PRIORITY: C

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
25 405 Main St									\$12,825		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None. Photo #: 14	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Detectable Warnings/Truncated Domes											
Where walk crosses or adjoins vehicular way not separated by curb, guard or handrails.	Yes		Sidewalk does not have a curb, blended condition does not provide cane detectability for blind pedestrians.	ADAAG: 4.3.2 T24: 1133B.8.5	Modify existing street as needed to provide a 6" high curb that is cane detectable by blind pedestrians.	89	LF	65	\$5,785	C	
Walks and Sidewalks											
Surface stable, firm, slip resistant.	Surfaces with <6% gradient shall have a medium salted finish.		There is no compliant driveway.	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a new driveway.	300	SF	8	\$2,400	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.6% - 3.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	330	SF	8	\$2,640	C	

PRIORITY: C

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
26 410 Main St									\$5,040		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	320	SF	8	\$2,560	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	310	SF	8	\$2,480	C	
27 414 Main St									\$5,430		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Uneven surfaces due to spaulding in sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	245	SF	14	\$3,430	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	250	SF	8	\$2,000	C	
47 115 Pine St									\$2,000		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	

PRIORITY: C

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
48 114 Pine St									\$3,280		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.7% - 3.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	120	SF	8	\$960	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	290	SF	8	\$2,320	C	
49 112 Pine St									\$1,920		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.7% - 3.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	240	SF	8	\$1,920	C	
62 329 Bush St									\$56		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 46" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	7	SF	8	\$56	C	

PRIORITY: C

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
66 115 Jessie St									\$3,500		

Curb Ramps & Landings

Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.	Curb ramp running slope is 16.2%, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C	
---	-----------------------------	---	----------------------------	---	---	-----	------	---------	---	--

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
-------------------	----------------------	-------------	-----------------------	-------------------	----------------------------	-----	--------------	--------------	---------------	----	--------------

Total Cost for Priority: D = \$167,405

Priority: D

Greenville PUBLIC RIGHT-OF-WAY Site Cost = \$167,405

1 132 Main St

\$6,428

Curb Ramps & Landings

Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D
--	-----	--	-------	--------------------------------	--	---	-----	------	---------	---

Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp does not have top landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D
---	-----------------------------	--	--	----------------------------	---	---	-----	------	---------	---

Walks and Sidewalks

Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.8% - 4.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	116	SF	8	\$928	D
--------------	---------------------------	--	---	----------------------------------	---	-----	----	---	-------	---

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
28 419 Main St									\$6,907		
Detectable Warnings/Truncated Domes											
Where walk crosses or adjoins vehicular way not separated by curb, guard or handrails.	Yes		Sidewalk does not have a curb, blended condition does not provide cane detectability for blind pedestrians.	ADAAG: 4.3.2 T24: 1133B.8.5	Modify existing street as needed to provide a 6" high curb that is cane detectable by blind pedestrians.	75	LF	65	\$4,875	D	
Walks and Sidewalks											
Surface stable, firm, slip resistant.	Surfaces with <6% gradient shall have a medium salted finish.		There is no compliant driveway.	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a new driveway.	200	SF	8	\$1,600	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	54	SF	8	\$432	D	
29 421 Main St									\$3,120		
Detectable Warnings/Truncated Domes											
Where walk crosses or adjoins vehicular way not separated by curb, guard or handrails.	Yes		Sidewalk does not have a curb, blended condition does not provide cane detectability for blind pedestrians.	ADAAG: 4.3.2 T24: 1133B.8.5	Modify existing street as needed to provide a 6" high curb that is cane detectable by blind pedestrians.	48	LF	65	\$3,120	D	

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
30 423 Main St									\$3,248		
Detectable Warnings/Truncated Domes											
Where walk crosses or adjoins vehicular way not separated by curb, guard or handrails.	Yes		Sidewalk does not have a curb, blended condition does not provide cane detestability for blind pedestrians.	ADAAG: 4.3.2 T24: 1133B.8.5	Modify existing street as needed to provide a 6" high curb that is cane detectable by blind pedestrians.	56	LF	40	\$2,240	D	
Walks and Sidewalks											
Surface stable, firm, slip resistant.		Surfaces with <6% gradient shall have a medium salted finish.	There is no compliant driveway.	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a new driveway.	126	SF	8	\$1,008	D	
31 427 Main St									\$1,560		
Detectable Warnings/Truncated Domes											
Where walk crosses or adjoins vehicular way not separated by curb, guard or handrails.	Yes		Sidewalk does not have a curb, blended condition does not provide cane delectability for blind pedestrians.	ADAAG: 4.3.2 T24: 1133B.8.5	Modify existing street as needed to provide a 6" high curb that is cane detectable by blind pedestrians.	24	LF	65	\$1,560	D	
32 429 Main St									\$1,820		
Detectable Warnings/Truncated Domes											
Where walk crosses or adjoins vehicular way not separated by curb, guard or handrails.	Yes		Sidewalk does not have a curb, blended condition does not provide cane detectability for blind pedestrians.	ADAAG: 4.3.2 T24: 1133B.8.5	Modify existing street as needed to provide a 6" high curb that is cane detectable by blind pedestrians.	28	LF	65	\$1,820	D	

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
33 430 Main St									\$15,710		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surfaces - vibration zone.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	90	SF	14	\$1,260	D	
Smooth surface, no excessive irregular surfaces.	Yes.		Uneven surfaces due to spaulding in sidewalk. Photo #: 8	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	425	SF	14	\$5,950	D	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surfaces - vibration zone.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	150	SF	14	\$2,100	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	800	SF	8	\$6,400	D	
34 435 Main St									\$7,364		
Detectable Warnings/Truncated Domes											
Where walk crosses or adjoins vehicular way not separated by curb, guard or handrails.	Yes		Sidewalk does not have a curb, blended condition does not provide cane detectability for blind pedestrians.	ADAAG: 4.3.2 T24: 1133B.8.5	Modify existing street as needed to provide a 6" high curb that is cane detectable by blind pedestrians.	100	LF	65	\$6,500	D	
Walks and Sidewalks											
Surface stable, firm, slip resistant.	Surfaces with <6% gradient shall have a medium salted finish.		There is no compliant driveway.	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a new driveway.	108	SF	8	\$864	D	

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
35 438 Main St									\$3,040		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.0% - 3.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	380	SF	8	\$3,040	D	
36 440 Main St									\$12,420		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp has an 8" lip, no detectable warnings and contrast with adjacent surfaces. Photo #: 9	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	D	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 8.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	1128	SF	8	\$9,024	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.1%. Photo #: 10	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	112	SF	8	\$896	D	

PRIORITY: D

28-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
37 441 Main St									\$4,460		
Detectable Warnings/Truncated Domes											
Where walk crosses or adjoins vehicular way not separated by curb, guard or handrails.	Yes		Sidewalk does not have a curb, blended condition does not provide cane detectability for blind pedestrians.	ADAAG: 4.3.2 T24: 1133B.8.5	Modify existing street as needed to provide a 6" high curb that is cane detectable by blind pedestrians.	52	LF	65	\$3,380	D	
Walks and Sidewalks											
Surface stable, firm, slip resistant.	Surfaces with <6% gradient shall have a medium salted finish.		There is no compliant driveway.	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a new driveway.	135	SF	8	\$1,080	D	

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
38 445 Main St									\$7,752		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp does not have top landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	D	
Detectable Warnings/Truncated Domes											
Where walk crosses or adjoins vehicular way not separated by curb, guard or handrails.	Yes		Sidewalk does not have a curb, blended condition does not provide cane detectability for blind pedestrians. Photo #: 13	ADAAG: 4.3.2 T24: 1133B.8.5	Modify existing street as needed to provide a 6" high curb that is cane detectable by blind pedestrians.	52	LF	65	\$3,380	D	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 5.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	234	SF	8	\$1,872	D	
39 504 Main St									\$2,840		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.2% - 6.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	355	SF	8	\$2,840	D	

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
40 520 Main St									\$6,240		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	200	SF	8	\$1,600	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.7% - 10.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	580	SF	8	\$4,640	D	
41 522 Main St									\$2,400		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.0%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	130	SF	8	\$1,040	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	170	SF	8	\$1,360	D	
42 528 Main St									\$1,200		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	150	SF	8	\$1,200	D	

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
43 536 Main St									\$2,400		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.3% - 3.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
44 544 Main St									\$2,360		
Walks and Sidewalks											
Surface stable, firm, slip resistant.		Surfaces with <6% gradient shall have a medium salted finish.	No driveway, uneven surfaces. Photo #: 11	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a new driveway with firm, stable and slip resistant surfaces.	90	SF	8	\$720	D	
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 2.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	205	SF	8	\$1,640	D	
45 546 Main St									\$2,000		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None. Photo #: 12	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
46 200 Mill St									\$3,800		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.3% - 3.0%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	225	JOB	8	\$1,800	D	

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
64 205 Grand St									\$37,280		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surfaces.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	940	SF	14	\$13,160	D	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surfaces.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	524	SF	14	\$7,336	D	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surfaces.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	488	SF	14	\$6,832	D	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surfaces.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	300	SF	14	\$4,200	D	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surfaces.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	188	SF	14	\$2,632	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	390	SF	8	\$3,120	D	

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
65 224 Grand St									\$5,560		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	D	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.3% due to tree upheave.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	70	SF	8	\$560	D	

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
66 115 Jessie St									\$4,400		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.5% - 3.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	90	SF	8	\$720	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	320	SF	8	\$2,560	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.0% - 5.0%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	68	SF	8	\$544	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.4% - 3.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	72	SF	8	\$576	D	
67 117 Jessie St									\$3,336		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	360	SF	8	\$2,880	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 4.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	57	SF	8	\$456	D	

PRIORITY: D

28-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
68 119 Jessie St									\$2,960		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.6% - 3.0%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	90	SF	8	\$720	D	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 9.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	280	SF	8	\$2,240	D	
69 121 Jessie St									\$2,000		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
70 211 Jessie St									\$7,380		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has deteriorating concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	250	SF	14	\$3,500	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.0% - 3.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	235	SF	8	\$1,880	D	
71 213 Jessie St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	

PRIORITY: D

28-Mar-11

Greenville PUBLIC RIGHT-OF-WAY Sitework



ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
72 217 Jessie St									\$5,020		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp does not have a rear landing, it does not have detectable warnings and contrast with adjacent surfaces. (170 SF)	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	D	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.8% - 3.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	145	SF	8	\$1,160	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.4% - 2.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	170	SF	8	\$1,360	D	
<u>Total Project Cost :</u>									<u>\$526,211</u>		