

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
-------------------	----------------------	-------------	-----------------------	-------------------	----------------------------	-----	--------------	--------------	---------------	----	--------------

Total Cost for Priority: A = \$398,377

Priority: A

Quincy PUBLIC RIGHT-OF-WAY Site Cost = \$398,377

3 115 Alder St

\$600

Hazards/Protruding Objects

Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor	Sign is an overhead obstruction mounted at 60" high.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Relocate sign to provide the required overhead clearance.	1	JOB	300	\$300	A
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor	Sign is an overhead obstruction mounted at 58" high.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign to provide 80" high overhead clearance.	1	JOB	300	\$300	A

4 162 Alder St

\$3,600

Walks and Sidewalks

Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 7.4%. Photo #: 4	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	450	SF	8	\$3,600	A
--	-----------------------------------	---	----------------------------------	--	-----	----	---	---------	---

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
5 170 Alder St									\$7,680		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		Curb ramp cross slope is 2.7%, it does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	710	SF	8	\$5,680	A	
6 200 Alder St									\$100		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		72" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
8 225 Alder St									\$2,220		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		72" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has uneven surfaces due to tree root upheave.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	240	SF	8	\$1,920	A	
10 322 Alder St									\$5,700		
Hazards/Protruding Objects											
Hazardous drop-off adjacent to walk way (not required between walks or sidewalks & adjacent streets or driveway; or if guard or handrail is provided with guide rail centered 2-4" above walk).	No abrupt changes in level >4" vertical (planters, fountains, ponds), 6" min. curb above the potential drop off (CA only)		Raised sidewalk has a 24" high curb. Photo #: 27	ADAAG: N.A. T24: 1133B.8.2 CHECK	Install a protective rail.	20	LF	40	\$800	A	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple pavement dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	350	SF	14	\$4,900	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
11 329 Alder St									\$100		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		48" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
15 10 Bradley St									\$5,600		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1" lip and uneven surfaces. Photo #: 1	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	450	SF	8	\$3,600	A	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
17 21 Bradley St									\$8,270		
Curb Ramps & Landings											
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with	Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800	A		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").	Sidewalk has a 3/4" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A		
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").	Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A		
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 5.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	A		
Cross slope.	Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 3.4%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	90	SF	8	\$720	A		
Cross slope.	Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 3.1%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	80	SF	8	\$640	A		
Cross slope.	Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 4.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	200	SF	8	\$1,600	A		

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.0%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	220	SF	8	\$1,760	A	
19 31 Bradley St									\$5,110		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple pavement dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	365	SF	14	\$5,110	A	
20 50 Bradley St									\$300		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		79" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
24 40 Buchanan St									\$2,900		
Curb Ramps & Landings											
Curb ramp finish complying with Section 1124B and Contrasting finish with adjacent sidewalk and detectable warning/truncated domes.	Curb ramp finish contrasting with adjacent sidewalk and detectable warnings shall contrast visually with adjoining surfaces, either light-on-dark, or dark-on-light with a 70% visual contrast.	Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.29.2 T24: 1127B.5.5 & 1127B.5.7	Provide curb ramp with contrasting finish from adjacent sidewalk, detectable warnings contrasting visually with adjoining surfaces either light-on-dark, or dark-on-light, when curb ramp is remodeled.	1	JOB	800	\$800		A	
Transition from curb ramps to walks, gutters or streets shall be flush and free of abrupt changes.	No curb ramp bottom landing lip allowed. Maximum slopes of adjoining gutters, road surface immediately adjacent to the curb ramp or accessible route shall not exceed 1 unit vertical to 20 units horizontal (5%) slope within 4 feet of the curb ramp bottom landing.	Curb ramp has a lip, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.3 & 1127B.5.5	Grind lip, provide new detectable warnings and contrasting color with adjacent surfaces.	1	JOB	1000	\$1,000		A	
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with	Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800		A	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)	Sidewalk is only 36" wide, but it also has a 72" high overhead obstruction, due to the location of sign.	ADAAG: 4.3.3 T24: 1133B.7.1	Move sign.	1	JOB	300	\$300		A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
25 47 Buchanan St									\$4,400		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
26 65 Buchanan St									\$6,520		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		64" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		60" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.4%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	425	SF	8	\$3,400	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	340	SF	8	\$2,720	A	
27 70 Buchanan St									\$3,824		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	290	SF	8	\$2,320	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.5% - 3.2%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	188	SF	8	\$1,504	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
28 80 Buchanan St									\$3,504		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	350	SF	8	\$2,800	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.7% - 4.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	88	SF	8	\$704	A	
29 20 Central Ave									\$300		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		68" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
31 50 Central Ave									\$250		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		60" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
32 50 Church St									\$448		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	56	SF	8	\$448	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
34 116 Circle Dr									\$5,574		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		62" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		72" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		60" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		72" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		52" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Minimum clear headroom, 80" high above finished floor min. and/or obstacle reduction of clear width of path of travel.	80" clear headroom from floor and/or >36" clearance, (32" permitted for a distance of no more than 24")		60" high to vegetation.	ADAAG: 4.4.2; 4.2.1 T24: 1133B.8.6.1	Trim existing tree or vegetation to provide compliant clearance.	1	JOB	50	\$50	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple pavement dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	80	SF	14	\$1,120	A	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple pavement dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	56	SF	14	\$784	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" dislocation.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	4	LF	35	\$140	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	4	LF	35	\$140	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has multiple pavement dislocations.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	330	SF	8	\$2,640	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
42 205 Coburn St									\$7,784		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	A	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 30" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	168	SF	8	\$1,344	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	430	SF	8	\$3,440	A	
43 221 Coburn St									\$4,544		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 30" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	228	SF	8	\$1,824	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	340	SF	8	\$2,720	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
44 233 Coburn St									\$5,424		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 30" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	128	SF	8	\$1,024	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
45 50 Court St									\$7,684		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.	Curb ramp top landing is 7.5%.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500		A	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 10%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400		A	
Cross slope.	Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.3% - 3.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	348	SF	8	\$2,784		A	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
46 65 Court St									\$7,960		
Curb Ramps & Landings											
Transition from curb ramps to walks, gutters or streets shall be flush and free of abrupt changes.	No curb ramp bottom landing lip allowed. Maximum slopes of adjoining gutters, road surface immediately adjacent to the curb ramp or accessible route shall not exceed 1 unit vertical to 20 units horizontal (5%) slope within 4 feet of the curb ramp bottom landing.		Curb ramp has a lip, no detectable warnings and contrast with adjacent surfaces. Photo #: 7	ADAAG: 4.7.2 T24: 1127B.5.3 & 1127B.5.5	Grind lip, provide new detectable warnings and contrasting color with adjacent surfaces.	1	JOB	1000	\$1,000	A	
Walks and Sidewalks											
Pavement dislocations, changes in level - due to the drop of Red Brick Stamp.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip adjacent to the brick border.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace, repair or raise Red Brick Stamp surface area as needed to correct abrupt change in level.	80	LF	15	\$1,200	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 5.0% - 5.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	400	SF	8	\$3,200	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.4% - 3.0%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	320	SF	8	\$2,560	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
47 75 Court St									\$1,150		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Grind lip, provide new detectable warnings and contrasting color with adjacent surfaces.	1	JOB	1000	\$1,000	A	
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a broken utility cover.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	1	JOB	150	\$150	A	
48 89 Court St									\$2,220		
Walks and Sidewalks											
Pavement dislocations, changes in level - due to the drop of Red Brick Stamp.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip adjacent to red brick. Photo #: 20	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace, repair or raise Red Brick Stamp surface area as needed to correct abrupt change in level.	20	LF	15	\$300	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.5%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	240	SF	8	\$1,920	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
49 11 Crescent St									\$7,560		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to small utility box.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip adjacent to utility box.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility box.	1	JOB	375	\$375	A	
Pavement dislocations, uneven surface - due to small utility box.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip adjacent to utility box.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility box.	1	JOB	375	\$375	A	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surfaces.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	75	SF	14	\$1,050	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	470	SF	8	\$3,760	A	
52 123 Crescent St									\$150		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a dip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
-------------------	----------------------	-------------	-----------------------	-------------------	----------------------------	-----	--------------	--------------	---------------	----	--------------

58 188 Crescent St

\$100

Walks and Sidewalks

Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	1	JOB	100	\$100	A	
--	--	--	--------------------------	--------------------------------	---	---	-----	-----	-------	---	--

65 294 Crescent St

\$280

Walks and Sidewalks

Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1" dislocation.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind	8	LF	35	\$280	A	
--	--	--	--------------------------------	--------------------------------	-------	---	----	----	-------	---	--

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
67 332 East High St									\$7,200		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp is broken.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	A	
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp is broken.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	A	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 30" wide, due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	A	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 30" wide, due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
71 85 Filmore St									\$150		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	
72 121 Filmore St									\$5,100		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		60" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	600	SF	8	\$4,800	A	
73 25 Harbison Ave									\$50		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has an empty hole.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	1	SF	50	\$50	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
77 75 Harbison Ave									\$4,356		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		72" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	60	SF	14	\$840	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.6% - 3.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	152	SF	8	\$1,216	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
79 35 Jackson St									\$1,125		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A	
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Lower utility cover.	1	JOB	150	\$150	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk is lifted.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	100	SF	8	\$800	A	
80 55 Jackson St									\$500		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		63" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		68" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		70" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
81 139 Jackson St									\$2,000		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		Curb ramp running slope is 9.6%.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
82 145 Jackson St									\$2,000		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
83 146 Jackson St									\$5,416		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	A	
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		50" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 39" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.6% - 3.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	252	SF	8	\$2,016	A	
84 151 Jackson St									\$2,640		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	330	SF	8	\$2,640	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
85 152 Jackson St									\$4,600		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.6% - 3.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	225	SF	8	\$1,800	A	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 10.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	350	SF	8	\$2,800	A	
86 157 Jackson St									\$5,200		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 6.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	650	SF	8	\$5,200	A	
87 158 Jackson St									\$936		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.8% - 3.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	117	SF	8	\$936	A	
88 163 Jackson St									\$3,840		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 6.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	480	SF	8	\$3,840	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
89 164 Jackson St									\$1,512		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 3.3%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	189	SF	8	\$1,512	A	
90 169 Jackson St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 5.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	A	
91 170 Jackson St									\$1,336		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.8% - 3.3%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	167	SF	8	\$1,336	A	
92 175 Jackson St									\$3,360		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 7.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	420	SF	8	\$3,360	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
93 176 Jackson St										\$3,232	
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.8% - 3.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	144	SF	8	\$1,152	A	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 10.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	260	JOB	8	\$2,080	A	
94 181 Jackson St										\$2,800	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 6.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	350	SF	8	\$2,800	A	
95 182 Jackson St										\$3,128	
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.6% - 3.8%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	171	SF	8	\$1,368	A	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 15.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	220	SF	8	\$1,760	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
-------------------	----------------------	-------------	-----------------------	-------------------	----------------------------	-----	--------------	--------------	---------------	----	--------------

96 187 Jackson St

\$4,990

Hazards/Protruding Objects

Guy supports, slanted utility guy wire adjacent to path of travel.	80" high clearance above finished floor min.	Sidewalk is only 42" wide, due to the location of utility pole and anchor.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Provide guy brace to obtain required 80" height clearance from walkway surface.	1	JOB	750	\$750	A
--	--	--	--------------------------------------	---	---	-----	-----	-------	---

Walks and Sidewalks

Cross slope.	Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 3.1%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	160	SF	8	\$1,280	A
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 6.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	370	SF	8	\$2,960	A

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
97 189 Jackson St									\$5,980		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		70" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 30" wide due to the location of tree.	ADAAG: 4.3.3 T24: 1133B.7.1	Relocate sidewalk.	120	SF	8	\$960	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.50%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	340	SF	8	\$2,720	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
98 192 Jackson St									\$8,936		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.	Broken curb ramp needs to be replaced, no detectable warnings and contrasting color with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	A		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)	Sidewalk is 25" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	A		
Cross slope.	Cross slope shall be <2%.	Sidewalk cross slope ranges from 3.0% - 3.5%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	297	SF	8	\$2,376	A		
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	370	SF	8	\$2,960	A		

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
99 205 Jackson St									\$740		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		60" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
Walks and Sidewalks											
Pavement dislocations, changes in level - due to the drop of Red Brick Stamp.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip adjacent to the brick border.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace, repair or raise Red Brick Stamp surface area as needed to correct abrupt change in level.	36	LF	15	\$540	A	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
100 208 Jackson St									\$3,700		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp is broken.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	A	
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		68" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Walks and Sidewalks											
Pavement dislocations, changes in level - due to the drop of Red Brick Stamp.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip adjacent to the brick border.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace, repair or raise Red Brick Stamp surface area as needed to correct abrupt change in level.	60	LF	15	\$900	A	
102 215 Jackson St									\$2,860		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	4	LF	35	\$140	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	340	SF	8	\$2,720	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
103 228 Jackson St									\$2,160		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	270	SF	8	\$2,160	A	
104 229 Jackson St									\$3,040		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	380	SF	8	\$3,040	A	
105 240 Jackson St									\$2,240		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	280	SF	8	\$2,240	A	
106 253 Jackson St									\$495		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		64" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Walks and Sidewalks											
Pavement dislocations, changes in level - due to the drop of Red Brick Stamp.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip adjacent to the brick border.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace, repair or raise Red Brick Stamp surface area as needed to correct abrupt change in level.	13	LF	15	\$195	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
107 269 Jackson St									\$5,170		
Curb Ramps & Landings											
Transition from curb ramps to walks, gutters or streets shall be flush and free of abrupt changes.	No curb ramp bottom landing lip allowed. Maximum slopes of adjoining gutters, road surface immediately adjacent to the curb ramp or accessible route shall not exceed 1 unit vertical to 20 units horizontal (5%) slope within 4 feet of the curb ramp bottom landing.		Curb ramp has a lip.	ADAAG: 4.7.2 T24: 1127B.5.3 & 1127B.5.5	Grind lip.	8	LF	50	\$400	A	
Walks and Sidewalks											
Pavement dislocations, changes in level - due to the drop of Red Brick Stamp.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip adjacent to the brick border.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace, repair or raise Red Brick Stamp surface area as needed to correct abrupt change in level.	30	LF	15	\$450	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	540	SF	8	\$4,320	A	
108 272 Jackson St									\$964		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 24" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Replace with sidewalk.	108	SF	8	\$864	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
109 282 Jackson St									\$3,600		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surfaces that produces a vibration zone.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	40	SF	14	\$560	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	380	SF	8	\$3,040	A	
110 307 Jackson St									\$3,430		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp does not have top landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	A	
Walks and Sidewalks											
Pavement dislocations, changes in level - due to the drop of Red Brick Stamp.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip adjacent to the brick border.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace, repair or raise Red Brick Stamp surface area as needed to correct abrupt change in level.	62	LF	15	\$930	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
111 314 Jackson St									\$2,200		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 24" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	A	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 38" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	A	
112 321 Jackson St									\$2,595		
Walks and Sidewalks											
Pavement dislocations, changes in level - due to the drop of Red Brick Stamp.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip adjacent to the brick border.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace, repair or raise Red Brick Stamp surface area as needed to correct abrupt change in level.	13	LF	15	\$195	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
113 326 Jackson St									\$2,820		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		61" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	A	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	340	SF	8	\$2,720	A	
114 333 Jackson St									\$3,968		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Asphalt pavement sidewalk has uneven surfaces.	ADAAG: 4.5.2 T24: 1133B.7.1	Replace asphalt pavement sidewalk.	224	SF	14	\$3,136	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Broken Driveway needs to be replaced.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	104	SF	8	\$832	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
115 344 Jackson St									\$3,940		
Curb Ramps & Landings											
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top or bottom landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	A	
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		68" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	2	LF	35	\$70	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	2	LF	35	\$70	A	
116 356 Jackson St									\$2,240		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	280	SF	8	\$2,240	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
117 363 Jackson St									\$3,500		
Curb Ramps & Landings											
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.	None.		ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	A	
118 379 Jackson St									\$3,780		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		72" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	370	SF	8	\$2,960	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	90	SF	8	\$720	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
119 380 Jackson St									\$300		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		66" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
120 385 Jackson St									\$2,080		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 4.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	260	SF	8	\$2,080	A	
121 390 Jackson St									\$2,688		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has uneven surfaces due to tree root upheave.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	336	SF	8	\$2,688	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
122 395 Jackson St									\$4,100		
Curb Ramps & Landings											
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top or bottom landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	A	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.0%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	75	SF	8	\$600	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
-------------------	----------------------	-------------	-----------------------	-------------------	----------------------------	-----	--------------	--------------	---------------	----	--------------

124 445 Jackson St

\$4,550

Curb Ramps & Landings

Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	A	
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with		Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800	A	

Walks and Sidewalks

Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Lower utility cover.	1	JOB	150	\$150	A	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 30" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Install wheel stops.	6	JOB	100	\$600	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
126 485 Jackson St									\$6,100		
Curb Ramps & Landings											
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top or bottom landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	A	
Parking and Passenger Loading Zones											
Wheel stop or no sidewalk/walk encroachment.	Parked vehicles overhands shall not reduce the clear width of an accessible route - Provide a Wheel stop.		Sidewalk is only 30" wide due to the encroachment of vehicles.	ADAAG: Fig.9 T24: 1129B.3.1 and 1129B.3.3	Install wheel stops, to maintain the required 48" wide sidewalk.	6	JOB	100	\$600	A	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.5%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	250	SF	8	\$2,000	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
127 500 Jackson St									\$5,300		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp cross slope is 3.2%, it does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	A	
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	A	
Walks and Sidewalks											
Rectangular gratings (walks shall be free of gratings if possible).	1/2" max. grid openings in direction of traffic flow.		40" grate at bottom of ramp.	ADAAG: 4.5.4 T24: 1133B.7.2	Replace grate cover.	1	JOB	300	\$300	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
130 525 Jackson St									\$8,410		
Curb Ramps & Landings											
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top or bottom landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	A	
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top or bottom landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	A	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	90	SF	14	\$1,260	A	
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	1	SF	50	\$50	A	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a 1/2" gap.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	2	SF	50	\$100	A	

PRIORITY: A

31-Mar-11

**Quincy PUBLIC RIGHT-OF-WAY
Sitework**

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
131 532 Jackson St									\$175		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A	
133 554 Jackson St									\$575		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	50	SF	8	\$400	A	
136 573 Jackson St									\$150		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	
137 583 Jackson St									\$700		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		72" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 3/4" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	50	SF	8	\$400	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
140 602 Jackson St									\$245		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	2	LF	35	\$70	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 3/4" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A	
141 603 Jackson St									\$300		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		There is not the required overhead clearance due to the location of stop sign. Photo #: 18	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
149 159 Lawrence St									\$360		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 3/4" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	45	SF	8	\$360	A	
151 170 Lawrence St									\$192		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1" dip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	24	SF	8	\$192	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
156 192 Lawrence St									\$175		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A	
167 314 Lawrence St									\$6,048		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple pavement dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	216	SF	14	\$3,024	A	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple pavement dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	216	SF	14	\$3,024	A	
170 333 Lawrence St									\$200		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		60" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		72" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
171 352 Lawrence St									\$224		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1" dip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	28	SF	8	\$224	A	
172 355 Lawrence St									\$150		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	
174 381 Lawrence St									\$100		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		72" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
175 391 Lawrence St									\$350		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 3/4" bump.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	25	SF	8	\$200	A	
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 3/4" lip. Photo #: 8	ADAAG: 4.5.2 T24: 1133B.7.4	Lower utility cover.	1	JOB	150	\$150	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
177 411 Lawrence St									\$300		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip due to the location of utility cover. Photo #: 9	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover and patch concrete as needed.	1	JOB	300	\$300	A	
179 437 Lawrence St									\$200		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	4	SF	50	\$200	A	
183 491 Lawrence St									\$100		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 30" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	A	
184 505 Lawrence St									\$150		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 3/4" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
186 522 Lawrence St									\$150		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" dislocation.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	1	JOB	150	\$150	A	
189 546 Lawrence St									\$968		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" dislocation.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	121	SF	8	\$968	A	
192 577 Lawrence St									\$2,384		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple pavement dislocations.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	96	SF	14	\$1,344	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has multiple pavement dislocations.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	130	SF	8	\$1,040	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
205 121 Main St									\$300		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 3/4" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	
212 145 Main St									\$150		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	
214 153 Main St									\$100		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		72" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
220 189 Main St									\$175		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	5	LF	35	\$175	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
222 197 Main St									\$384		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" hole.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover, replace concrete surface as needed.	32	SF	8	\$256	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1" hole.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover, replace concrete surface as needed.	16	SF	8	\$128	A	
228 268 Main St									\$150		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Raise utility cover.	1	JOB	150	\$150	A	
229 269 Main St									\$945		
Walks and Sidewalks											
Pavement dislocations, changes in level - due to the drop of Red Brick Stamp.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1" lip adjacent to the brick border.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace, repair or raise Red Brick Stamp surface area as needed to correct abrupt change in level.	63	LF	15	\$945	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
232 304 Main St									\$4,328		
Curb Ramps & Landings											
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with	Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800		A	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.9% - 3.6%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	441	SF	8	\$3,528		A	
233 306 Main St									\$100		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)	Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100		A	
235 314 Main St									\$4,144		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.6% - 3.0%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	518	SF	8	\$4,144		A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
236 315 Main St									\$4,800		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 3/4" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	32	SF	150	\$4,800	A	
238 326 Main St									\$4,088		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 4.4% - 5.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	511	SF	8	\$4,088	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
240 336 Main St									\$11,580		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	A	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 13.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	380	SF	8	\$3,040	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 5.2% - 6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	90	SF	8	\$720	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.8% - 5.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	540	SF	8	\$4,320	A	
245 59 South Lindan Ave									\$300		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		48" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
246 60 South Lindan Ave									\$300		
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		50" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
248 355 Stephan Way									\$140		
Walks and Sidewalks											
Smooth surface.	Yes.		Sidewalk has a 1/2" lip/dislocation.	ADAAG: 4.5.2 T24: 1133B.7.1	Smooth surface; grind pavement surface.	4	LF	35	\$140	A	
249 360 Stephan Way									\$1,840		
Hazards/Protruding Objects											
Hazardous drop-off adjacent to walk way (not required between walks or sidewalks & adjacent streets or driveway; or if guard or handrail is provided with guide rail centered 2-4" above walk).	No abrupt changes in level >4" vertical (planters, fountains, ponds), 6" min. curb above the potential drop off (CA only)		Raised sidewalk has a 24" high curb.	ADAAG: N.A. T24: 1133B.8.2 CHECK	Install a protective rail.	46	LF	40	\$1,840	A	
250 373 Stephan Way									\$280		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	8	LF	35	\$280	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
251 380 Stephan Way									\$1,840		
Hazards/Protruding Objects											
Hazardous drop-off adjacent to walk way (not required between walks or sidewalks & adjacent streets or driveway; or if guard or handrail is provided with guide rail centered 2-4" above walk).	No abrupt changes in level >4" vertical (planters, fountains, ponds), 6" min. curb above the potential drop off (CA only)		Raised sidewalk has a 24" high curb.	ADAAG: N.A. T24: 1133B.8.2 CHECK	Install a protective rail.	46	LF	40	\$1,840	A	
252 390 Stephan Way									\$2,400		
Hazards/Protruding Objects											
Hazardous drop-off adjacent to walk way (not required between walks or sidewalks & adjacent streets or driveway; or if guard or handrail is provided with guide rail centered 2-4" above walk).	No abrupt changes in level >4" vertical (planters, fountains, ponds), 6" min. curb above the potential drop off (CA only)		Raised sidewalk has a 24" high curb.	ADAAG: N.A. T24: 1133B.8.2 CHECK	Install a protective rail.	60	LF	40	\$2,400	A	
253 391 Stephan Way									\$644		
Walks and Sidewalks											
Smooth surface.	Yes.		Sidewalk has a 1/2" lip/dislocation.	ADAAG: 4.5.2 T24: 1133B.7.1	Smooth surface; grind pavement surface.	12	LF	35	\$420	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	28	SF	8	\$224	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
254 571 West Main St									\$7,800		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with		Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800	A	
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		72" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a broken curb.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	325	SF	14	\$4,550	A	
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a broken utility cover.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	1	JOB	150	\$150	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
255 570 West Main St									\$8,100		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		Curb ramp running slope is 13.7%.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	A	
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp 30" wide, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	A	
Transition from curb ramps to walks, gutters or streets shall be flush and free of abrupt changes.	No curb ramp bottom landing lip allowed. Maximum slopes of adjoining gutters, road surface immediately adjacent to the curb ramp or accessible route shall not exceed 1 unit vertical to 20 units horizontal (5%) slope within 4 feet of the curb ramp bottom landing.		Curb ramp has a lip, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.3 & 1127B.5.5	Grind lip, provide new detectable warnings and contrasting color with adjacent surfaces.	1	JOB	1000	\$1,000	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
Transition from curb ramps to walks, gutters or streets shall be flush and free of abrupt changes.	No curb ramp bottom landing lip allowed. Maximum slopes of adjoining gutters, road surface immediately adjacent to the curb ramp or accessible route shall not exceed 1 unit vertical to 20 units horizontal (5%) slope within 4 feet of the curb ramp bottom landing.		Curb ramp has a lip, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.3 & 1127B.5.5	Grind lip, provide new detectable warnings and contrasting color with adjacent surfaces.	1	JOB	1000	\$1,000	A	
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		63" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		72" high overhead clearance due to the location of sign.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Raise sign.	1	JOB	300	\$300	A	

263 1986 East Main St

\$128

Walks and Sidewalks

Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	16	SF	8	\$128	A	
--	--	--	--------------------------	--------------------------------	---	----	----	---	-------	---	--

265 2004 East Main St

\$128

Walks and Sidewalks

Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	16	SF	8	\$128	A	
--	--	--	--------------------------	--------------------------------	---	----	----	---	-------	---	--

PRIORITY: A

31-Mar-11

**Quincy PUBLIC RIGHT-OF-WAY
Sitework**

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
269 2020 East Main St										\$50	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a hole.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	1	SF	50	\$50	A	
270 2034 East Main St										\$128	
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	16	SF	8	\$128	A	
279 2085 East Main St										\$16	
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a hole. Photo #: 22	ADAAG: 4.5.2 T24: 1133B.7.4	Patch existing surface.	2	SF	8	\$16	A	
286 2130 East Main St										\$128	
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	16	SF	8	\$128	A	
302 2308 East Main St										\$100	
Hazards/Protruding Objects											
Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		58" high overhead clearance due to the location of vegetation. Photo #: 30	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
311 10 Fairgrounds Rd									\$6,040		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	2	SF	50	\$100	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	6	LF	35	\$210	A	
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Grind or repair pavement dislocation to create beveled transition 1:2 max.	6	LF	35	\$210	A	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	440	SF	8	\$3,520	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
314 54 Fairgrounds Rd									\$20,172		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		Curb ramp running slope is 17.4%.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top landing, flare is 28.7%, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	A	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.4% - 4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	1008	SF	8	\$8,064	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 3.1% - 4.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	576	SF	8	\$4,608	A	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
318 100 Fairgrounds Rd									\$20,500		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		Curb ramp cross slope is flare is 28%, it does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	A	
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp flare is 28% slope.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	A	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.6% - 4.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	296	SF	8	\$2,368	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.5% - 2.9%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	380	SF	8	\$3,040	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.0%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	168	SF	8	\$1,344	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 4.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	264	SF	8	\$2,112	A	

PRIORITY: A

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.4%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	96	SF	8	\$768	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.4%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	304	SF	8	\$2,432	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.1%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	232	SF	8	\$1,856	A	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	260	SF	8	\$2,080	A	

329 25 Mill Creek Rd

\$290

Hazards/Protruding Objects

Minimum clear headroom, 80" high above finished floor min.	Cane detectable barrier within 27" from floor		72" high overhead clearance due to the location of vegetation.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Trim vegetation to provide the required overhead clearance.	1	JOB	100	\$100	A	
--	---	--	--	----------------------------------	---	---	-----	-----	-------	---	--

Walks and Sidewalks

Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Lower utility cover.	1	JOB	150	\$150	A	
Smooth surface, no irregular surfaces or gaps.	Gaps no more than 1/2" in the direction of travel.		Sidewalk has uneven surfaces under- drain.	ADAAG: 4.5.2 T24: 1133B7.1	Fill in with concrete.	5	SF	8	\$40	A	

PRIORITY: B

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
----------------	-------------------	-------------	--------------------	----------------	-------------------------	-----	-----------	-----------	------------	----	-----------

Total Cost for Priority: B = \$51,088

Priority: B Quincy PUBLIC RIGHT-OF-WAY Site Cost = \$51,088

34 116 Circle Dr \$21,368

Curb Ramps & Landings

Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with	Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800	B
---	---	--	---	---	---	-----	-----	-------	---

Walks and Sidewalks

Walk/sidewalk width.	36" ADA, 48" min. (CA only)	Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	B
Walk/sidewalk width.	36" ADA, 48" min. (CA only)	Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	B
Walk/sidewalk width.	36" ADA, 48" min. (CA only)	Sidewalk is 42" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	B
Walk/sidewalk width.	36" ADA, 48" min. (CA only)	Sidewalk is 42" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	B

PRIORITY: B

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 44" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	B	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 42" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	B	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.6% - 3.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	147	SF	8	\$1,176	B	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.5% - 5.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	400	SF	8	\$3,200	B	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.5% - 6.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	520	SF	8	\$4,160	B	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 4.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	220	SF	8	\$1,760	B	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	432	SF	8	\$3,456	B	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.6% - 5.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	225	SF	8	\$1,800	B	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.4% - 4.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	252	SF	8	\$2,016	B	

PRIORITY: B

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 4.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	B	

70 80 Filmore St

\$7,360

Curb Ramps & Landings

Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	B	
--	-----	--	-------	--------------------------------	--	---	-----	------	---------	---	--

Walks and Sidewalks

Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 5.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	370	SF	8	\$2,960	B	
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.3% - 7.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	B	

PRIORITY: B

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
71 85 Filmore St									\$14,840		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	B	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	380	SF	8	\$3,040	B	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	745	SF	8	\$5,960	B	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	480	SF	8	\$3,840	B	
329 25 Mill Creek Rd									\$1,560		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 4.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	195	SF	8	\$1,560	B	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
330 1002 Pioneer Rd									\$5,960		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	B	
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	B	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.9%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	120	SF	8	\$960	B	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
----------------	-------------------	-------------	--------------------	----------------	-------------------------	-----	-----------	-----------	------------	----	-----------

Total Cost for Priority: C = \$772,160

Priority: C Quincy PUBLIC RIGHT-OF-WAY Site Cost = \$772,160

15 10 Bradley St \$700

Walks and Sidewalks

Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk with asphalt concrete patch. Photo #: 21	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	50	SF	14	\$700	C	
--	------	--	---	--------------------------------	--	----	----	----	-------	---	--

16 20 Bradley St \$4,070

Curb Ramps & Landings

Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		Curb ramp cross slope is 4.4%, it does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
--	-----	--	--	--------------------------------	--	---	-----	------	---------	---	--

Walks and Sidewalks

Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a broken utility cover.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	1	JOB	150	\$150	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.6% - 5.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	240	SF	8	\$1,920	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
18 30 Bradley St									\$3,152		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Walks and Sidewalks											
Walk/sidewalk width.		36" ADA, 48" min. (CA only)	Sidewalk is only 36" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	144	SF	8	\$1,152	C	
19 31 Bradley St									\$3,120		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Walks and Sidewalks											
Walk/sidewalk width.		36" ADA, 48" min. (CA only)	Sidewalk is 45" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	140	SF	8	\$1,120	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
20 50 Bradley St									\$4,096		
Curb Ramps & Landings											
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with		Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800	C	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 36" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	412	SF	8	\$3,296	C	
21 61 Bradley St									\$2,160		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 4.20%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	270	SF	8	\$2,160	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
-------------------	----------------------	-------------	-----------------------	-------------------	----------------------------	-----	--------------	--------------	---------------	----	--------------

22 81 Bradley St

\$4,002

Curb Ramps & Landings

Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
--	-----	--	-------	--------------------------------	--	---	-----	------	---------	---	--

Walks and Sidewalks

Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surfaces that produces a vibration zone.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	143	SF	14	\$2,002	C	
--	------	--	--	--------------------------------	--	-----	----	----	---------	---	--

23 91 Bradley St

\$3,072

Walks and Sidewalks

Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.2%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	384	SF	8	\$3,072	C	
--------------	---------------------------	--	--	----------------------------------	---	-----	----	---	---------	---	--

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
30 32 Central Ave									\$5,830		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a broken curb.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	1	SF	50	\$50	C	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a broken curb.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	1	SF	50	\$50	C	
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a broken utility cover.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	1	JOB	150	\$150	C	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 35" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	520	SF	8	\$4,160	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.4% - 4.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	55	SF	8	\$440	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.8%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	110	SF	8	\$880	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
31 50 Central Ave									\$14,840		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	C	
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.6% - 4.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	800	SF	8	\$6,400	C	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 10.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	280	SF	8	\$2,240	C	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 11.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	400	SF	8	\$3,200	C	
32 50 Church St									\$400		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 3.0%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	50	SF	8	\$400	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
33 60 Church St									\$5,948		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	380	SF	8	\$3,040	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	80	SF	8	\$640	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.4% - 3.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	21	SF	8	\$168	C	
45 50 Court St									\$2,688		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.8%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	336	SF	8	\$2,688	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
47 75 Court St									\$480		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 2.9%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	60	SF	8	\$480	C	
50 23 Crescent St									\$4,150		
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.		36" ADA, 48" min. (CA only)	Sidewalk is 36" wide due to the location of planter.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Move planter.	1	JOB	150	\$150	C	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	500	SF	8	\$4,000	C	
51 45 Crescent St									\$4,160		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 12.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	520	SF	8	\$4,160	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
52 123 Crescent St									\$15,680		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	540	SF	8	\$4,320	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.9% - 3.6%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	200	SF	8	\$1,600	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	1100	SF	8	\$8,800	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.3% - 3.6%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	120	SF	8	\$960	C	
53 106 Crescent St									\$7,840		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 4.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	480	SF	8	\$3,840	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	500	SF	8	\$4,000	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
54 132 Crescent St									\$2,640		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	330	SF	8	\$2,640	C	
55 141 Crescent St									\$3,840		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	480	SF	8	\$3,840	C	
56 146 Crescent St									\$4,240		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	530	SF	8	\$4,240	C	
57 151 Crescent St									\$9,920		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	620	SF	8	\$4,960	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	620	SF	8	\$4,960	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
58 188 Crescent St									\$9,440		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	620	SF	8	\$4,960	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	460	SF	8	\$3,680	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.8%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	100	SF	8	\$800	C	
59 189 Crescent St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
60 199 Crescent St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
61 200 Crescent St									\$19,248		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		None	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	136	SF	14	\$1,904	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	200	SF	8	\$1,600	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Replace with sidewalk.	72	SF	8	\$576	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	530	SF	8	\$4,240	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3% - 5.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	400	SF	8	\$3,200	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.5% - 4.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	56	SF	8	\$448	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 13.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	370	SF	8	\$2,960	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	540	SF	8	\$4,320	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
62 221 Crescent St									\$3,840		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	480	SF	8	\$3,840	C	
63 233 Crescent St									\$8,512		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	500	SF	8	\$4,000	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.1% - 3.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	64	SF	8	\$512	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 12.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	500	SF	8	\$4,000	C	
64 285 Crescent St									\$4,000		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	500	SF	8	\$4,000	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
65 294 Crescent St									\$13,588		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a broken curb.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	2	SF	50	\$100	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	550	SF	8	\$4,400	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	600	SF	8	\$4,800	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.0% - 5.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	536	SF	8	\$4,288	C	
66 289 Crescent St									\$6,160		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	520	SF	8	\$4,160	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
73 25 Harbison Ave									\$9,062		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a broken utility cover.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	1	JOB	150	\$150	C	
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	96	SF	14	\$1,344	C	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a broken curb.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	232	SF	14	\$3,248	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3.5%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	290	SF	8	\$2,320	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
74 34 Harbison Ave									\$2,040		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	95	SF	8	\$760	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 5.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	160	SF	8	\$1,280	C	
75 46a Harbison Ave									\$840		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	60	SF	14	\$840	C	
104 229 Jackson St									\$1,760		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.9%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	220	SF	8	\$1,760	C	
131 532 Jackson St									\$920		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.9% - 2.3%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	115	SF	8	\$920	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
144 119 Lawrence St									\$10,896		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	C	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	290	SF	8	\$2,320	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.6% - 3.9%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	207	SF	8	\$1,656	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	490	SF	8	\$3,920	C	
148 145 Lawrence St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
149 159 Lawrence St									\$6,560		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	1	SF	50	\$50	C	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a broken curb.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	1	SF	50	\$50	C	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	4	SF	50	\$200	C	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.9% - 4.8%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	600	SF	8	\$4,800	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.2%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	120	SF	8	\$960	C	

152 173 Lawrence St

\$6,800

Walks and Sidewalks

Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 2.9%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	850	SF	8	\$6,800	C	
--	-----------------------------------	--	------------------------------	----------------------------------	--	-----	----	---	---------	---	--

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
154 179 Lawrence St									\$26,520		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 2.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	1200	SF	8	\$9,600	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3.8%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	330	SF	8	\$2,640	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	440	SF	8	\$3,520	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.1% - 3.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	45	SF	8	\$360	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway ramps are 17.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	320	SF	8	\$2,560	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 4.70%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	480	SF	8	\$3,840	C	

157 211 Lawrence St

\$5,760

Walks and Sidewalks

Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 12.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	440	SF	8	\$3,520	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.0% - 3.9%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	128	SF	8	\$1,024	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.6% - 4.4%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	152	SF	8	\$1,216	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
158 222 Lawrence St									\$46,616		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, running slope 10.4%, flare slope 21.8%, no detectable warnings and contrasting color with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C	
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, running slope 10.4%, flare slope 21.8%, no detectable warnings and contrasting color with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surfaces that produces a vibration zone.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	252	SF	14	\$3,528	C	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surfaces that produces a vibration zone.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	252	SF	14	\$3,528	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 6.0%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	373	SF	8	\$2,984	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	430	SF	8	\$3,440	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 6.0%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	373	SF	8	\$2,984	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 4.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	162	SF	8	\$1,296	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 4.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	162	SF	8	\$1,296	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	430	SF	8	\$3,440	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 4.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	600	SF	8	\$4,800	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	470	SF	8	\$3,760	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	470	SF	8	\$3,760	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 4.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	600	SF	8	\$4,800	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
159 227 Lawrence St									\$352		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.7% - 3.4%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	44	SF	8	\$352	C	
160 237 Lawrence St									\$640		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.5% - 4.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	80	SF	8	\$640	C	
161 247 Lawrence St									\$5,800		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	380	SF	14	\$5,320	C	
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 4.8%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	60	SF	8	\$480	C	
162 291 Lawrence St									\$7,024		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 13.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	770	SF	8	\$6,160	C	
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 3.3%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	108	SF	8	\$864	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
163 293 Lawrence St									\$1,728		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.3% - 5.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	216	SF	8	\$1,728	C	
164 295 Lawrence St									\$432		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway flare has 25.5% slope.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	27	SF	8	\$216	C	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway flare has 19.4% slope.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	27	SF	8	\$216	C	
165 304 Lawrence St									\$3,500		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".		Multiple code requirements.	Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
167 322 Lawrence St									\$10,240		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	400	SF	8	\$3,200	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	400	SF	8	\$3,200	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	240	SF	8	\$1,920	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	240	SF	8	\$1,920	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
169 330 Lawrence St									\$10,950		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	261	SF	14	\$3,654	C	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.4%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	162	SF	8	\$1,296	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
171 352 Lawrence St									\$5,920		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	470	SF	8	\$3,760	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 5.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	270	SF	8	\$2,160	C	
173 378 Lawrence St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
176 392 Lawrence St									\$1,352		
Curb Ramps & Landings											
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with		Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800	C	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 4.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	69	SF	8	\$552	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
178 432 Lawrence St									\$6,572		
Curb Ramps & Landings											
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top or bottom landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 4.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	384	SF	8	\$3,072	C	
180 440 Lawrence St									\$5,168		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.4%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	116	SF	8	\$928	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	530	SF	8	\$4,240	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
182 480 Lawrence St									\$6,160		
Curb Ramps & Landings											
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with		Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800	C	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	330	SF	8	\$2,640	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	340	SF	8	\$2,720	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
184 505 Lawrence St									\$3,032		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp is too small.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	C	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a 1/2" crack.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	2	SF	50	\$100	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway flare has 15.8% slope.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	27	SF	8	\$216	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway flare has 11.6% slope.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	27	SF	8	\$216	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
185 510 Lawrence St									\$5,568		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		Curb ramp cross slope is 6.2%, it does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 36" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	108	SF	8	\$864	C	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	116	SF	8	\$928	C	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 36" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	60	SF	8	\$480	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.6% - 5.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	162	SF	8	\$1,296	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
186 522 Lawrence St									\$3,416		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway flare has 11.3% slope.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	27	SF	8	\$216	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	400	SF	8	\$3,200	C	
187 535 Lawrence St									\$5,278		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	60	SF	14	\$840	C	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	27	SF	14	\$378	C	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	50	SF	14	\$700	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3.6%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	420	SF	8	\$3,360	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
188 545 Lawrence St									\$100		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 37" wide due to the location of vegetation. Photo #: 10	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	
189 546 Lawrence St									\$1,072		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.5% - 3.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	80	SF	8	\$640	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway flare has 15.2% slope.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	27	SF	8	\$216	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway flare has 17.7% slope.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	27	SF	8	\$216	C	
190 557 Lawrence St									\$1,008		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.4% - 3.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	126	SF	8	\$1,008	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
191 562 Lawrence St									\$9,748		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	40	SF	14	\$560	C	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	520	SF	8	\$4,160	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	340	SF	8	\$2,720	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.8% - 4.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	276	SF	8	\$2,208	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
192 577 Lawrence St									\$5,296		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	270	SF	8	\$2,160	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 4.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.6% - 3.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	67	SF	8	\$536	C	
193 591 Lawrence St									\$2,000		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		Curb ramp cross slope is 3.9%, it does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
194 25 Main St									\$6,572		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp is too small.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.5% - 5.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	384	SF	8	\$3,072	C	
195 51 Main St									\$5,020		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp is too small.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.0%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	190	SF	8	\$1,520	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
196 55 Main St									\$672		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.1% - 3.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	84	SF	8	\$672	C	
197 60 Main St									\$9,320		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp does not have top or bottom landing, no detectable warnings and contrast with adjacent surfaces. Cross slope is 9%.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	C	
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Uneven surfaces due to the location of steel utility cover.	ADAAG: 4.5.2 T24: 1133B.7.4	Replace utility cover.	1	JOB	500	\$500	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 12%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	790	SF	8	\$6,320	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
198 65 Main St									\$2,450		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a hole.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	1	SF	50	\$50	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
199 79 Main St									\$23,024		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Concrete patched with asphalt concrete. Photo #: 12	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	616	SF	14	\$8,624	C	
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	480	SF	14	\$6,720	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	480	SF	8	\$3,840	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	480	SF	8	\$3,840	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
200 80 Main St									\$6,432		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 45" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	64	SF	8	\$512	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	370	SF	8	\$2,960	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	370	SF	8	\$2,960	C	
201 84 Main St									\$8,122		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 41" wide due to the location of sign.	ADAAG: 4.3.3 T24: 1133B.7.1	Move sign.	1	JOB	250	\$250	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	360	SF	8	\$2,880	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	320	SF	8	\$2,560	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.4% - 3.6%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	304	SF	8	\$2,432	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
208 129 Main St									\$400		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.7% - 2.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	50	SF	8	\$400	C	
225 230 Main St									\$4,704		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.4% - 4.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	268	SF	8	\$2,144	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	320	SF	8	\$2,560	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
226 237 Main St									\$14,052		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp does not have top or bottom landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	C	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	500	SF	8	\$4,000	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.9%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	364	SF	8	\$2,912	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	580	SF	8	\$4,640	C	
227 248 Main St									\$2,304		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	48	SF	8	\$384	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.3% - 4.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	240	SF	8	\$1,920	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
230 279 Main St									\$228		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surface. Photo #: 33	ADAAG: 4.5.2 T24: 1133B.7.1	Patch uneven surface.	2	SF	14	\$28	C	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 42" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	25	SF	8	\$200	C	
231 295 Main St									\$7,628		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.1%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	136	SF	8	\$1,088	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	380	SF	8	\$3,040	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
234 307 Main St									\$3,500		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C	

237 325 Main St									\$1,956		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	112	SF	8	\$896	C	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 3.3%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	120	SF	8	\$960	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
239 335 Main St									\$1,444		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk width is reduced to 36" due to the location of vegetation. Photo #: 34	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.4% - 3.5%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	168	SF	8	\$1,344	C	
241 345 Main St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 12.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
242 347 Main St									\$1,024		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.7% - 5.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	128	SF	8	\$1,024	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
243 355 Main St									\$3,616		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.6% - 4.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	152	SF	8	\$1,216	C	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 11.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
244 90 Railway Ave									\$2,960		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.3% - 4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	120	SF	8	\$960	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
256 1879 East Main St									\$10,500		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top or bottom landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.4% - 3.7%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	325	SF	8	\$2,600	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.9%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	180	SF	8	\$1,440	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope has a steep flare.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	35	SF	8	\$280	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 3.4%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	85	SF	8	\$680	C	
257 1905 East Main St									\$4,240		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 5.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	530	SF	8	\$4,240	C	
258 1918 East Main St									\$6,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 11.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	420	SF	8	\$3,360	C	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 13.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	380	SF	8	\$3,040	C	
259 1946 East Main St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 6.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
260 1947 East Main St									\$3,360		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 11.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	420	SF	8	\$3,360	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
261 1953 East Main St									\$8,080		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 24" wide. Photo #: 26	ADAAG: 4.3.3 T24: 1133B.7.1	Install wheel stops.	8	JOB	100	\$800	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	480	SF	8	\$3,840	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	430	SF	8	\$3,440	C	
262 1970 East Main St									\$8,480		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	530	SF	8	\$4,240	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	530	SF	8	\$4,240	C	
263 1986 East Main St									\$3,440		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 12.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	430	SF	8	\$3,440	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
-------------------	----------------------	-------------	-----------------------	-------------------	----------------------------	-----	--------------	--------------	---------------	----	--------------

264 1995 East Main St

\$4,300

Curb Ramps & Landings

Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.	Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	C
---	-----------------------------	--	--------------------------------	--	---	-----	------	---------	---

Walks and Sidewalks

Cross slope.	Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 3.0%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	225	SF	8	\$1,800	C
--------------	---------------------------	--	--------------------------------------	---	-----	----	---	---------	---

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
265 2004 East Main St									\$7,268		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	C	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a broken curb.	ADAAG: 4.5.2 T24: 1133B.7.1	Replace broken curb.	2	SF	14	\$28	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	530	SF	8	\$4,240	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
266 2007 East Main St									\$9,716		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top or bottom landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	C	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 12%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	620	SF	8	\$4,960	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.1% - 4.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	282	SF	8	\$2,256	C	
267 2011 East Main St									\$880		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.5% - 4.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	110	SF	8	\$880	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
268 2019 East Main St									\$5,496		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope is 3.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	307	SF	8	\$2,456	C	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 12.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	380	SF	8	\$3,040	C	
269 2020 East Main St									\$7,280		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 11.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	530	SF	8	\$4,240	C	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 11.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	380	SF	8	\$3,040	C	
270 2034 East Main St									\$5,840		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 8.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	730	SF	8	\$5,840	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
271 2043 East Main St									\$6,176		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	520	SF	8	\$4,160	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 4.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	252	SF	8	\$2,016	C	
272 2048 East Main St									\$4,160		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.0% - 3.4%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	220	SF	8	\$1,760	C	
273 2055 East Main St									\$5,000		
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is only 24" wide. Photo #: 23	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Move utility pole to provide the required minimum clear route of travel. Provide a bracing for the utility anchor to have 80" high overhead clearance.	1	JOB	5000	\$5,000	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
274 2056 East Main St									\$3,450		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a broken curb.	ADAAG: 4.5.2 T24: 1133B.7.1	Replace broken curb.	1	SF	250	\$250	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	400	SF	8	\$3,200	C	
275 2061 East Main St									\$9,640		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.0% - 3.1%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	905	SF	8	\$7,240	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
276 2072 East Main St									\$3,840		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	480	SF	8	\$3,840	C	
277 2077 East Main St									\$6,560		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	820	SF	8	\$6,560	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
278 2080 East Main St									\$6,240		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 12.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	480	SF	8	\$3,840	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
279 2085 East Main St									\$10,920		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	C	
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with		Curb ramp does not have detectable warnings and contrasting color with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800	C	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.1% - 3.5%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	320	SF	8	\$2,560	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	189	SF	8	\$1,512	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	81	SF	8	\$648	C	
280 2088 East Main St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 13.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
281 2095 East Main St									\$3,280		
Walks and Sidewalks											
Slip resistant surface slope.	<6% medium salted		Sidewalk has dirt, not slip resistant.	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a slip resistant surface medium salted finish when slope is <6%.	40	SF	8	\$320	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	370	SF	8	\$2,960	C	
282 2096 East Main St									\$4,120		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 3.2%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	215	SF	8	\$1,720	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
283 2098 East Main St									\$3,500		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.	Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C		
284 2115 East Main St									\$13,280		
Walks and Sidewalks											
Surface stable, firm, slip resistant.	Surfaces with <6% gradient shall have a medium salted finish.	Sidewalk has dirt and is not slip resistant. Photo #: 15	ADAAG: 4.5.1 T24: 1133B.7.1.1	Re-build the sidewalk to be slip resistant.	320	SF	8	\$2,560	C		
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 9.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C		
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 9.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	520	SF	8	\$4,160	C		
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 8.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	520	SF	8	\$4,160	C		

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
287 2140 East Main St									\$13,480		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 24" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Remove gravel.	25	LF	200	\$5,000	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	500	SF	8	\$4,000	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	460	SF	8	\$3,680	C	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.5% - 3.6%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	100	SF	8	\$800	C	
288 2163 East Main St									\$7,400		
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is only 24" wide.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Relocate utility pole to provide required minimum clear path of travel.	1	JOB	5000	\$5,000	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
289 2176 East Main St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
291 2205 East Main St									\$10,480		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	580	SF	8	\$4,640	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	730	SF	8	\$5,840	C	
294 2221 East Main St									\$9,280		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	580	SF	8	\$4,640	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	580	SF	8	\$4,640	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
296 2239 East Main St									\$4,220		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top or bottom landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	C	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11%. Photo #: 16	ADAAG: 4.3.7 T24: 1133B.7.1.3	Replace with sidewalk.	90	SF	8	\$720	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
301 2289 East Main St									\$8,800		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Walks and Sidewalks											
Slip resistant surface slope.	<6% medium salted		Sidewalk has dirt, not slip resistant.	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a slip resistant surface medium salted finish when slope is <6%.	600	SF	8	\$4,800	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
303 2313 East Main St									\$7,160		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	C	
Walks and Sidewalks											
Slip resistant surface slope.	<6% medium salted		Sidewalk has dirt, not slip resistant.	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a slip resistant surface medium salted finish when slope is <6%.	520	SF	8	\$4,160	C	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
307 2335 East Main St									\$14,720		
Walks and Sidewalks											
Slip resistant surface slope.	<6% medium salted		Sidewalk has dirt, not slip resistant.	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a slip resistant surface medium salted finish when slope is <6%.	192	SF	8	\$1,536	C	
Slip resistant surface slope.	<6% medium salted		Sidewalk has dirt, not slip resistant.	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a slip resistant surface medium salted finish when slope is <6%.	148	SF	8	\$1,184	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	720	SF	8	\$5,760	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	580	SF	8	\$4,640	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Replace with sidewalk.	200	SF	8	\$1,600	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
309 2345 East Main St									\$6,400		
Walks and Sidewalks											
Slip resistant surface slope.	<6% medium salted		Sidewalk has dirt, not slip resistant.	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a slip resistant surface medium salted finish when slope is <6%.	200	SF	8	\$1,600	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	
310 2353 East Main St									\$5,200		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	C	
Walks and Sidewalks											
Slip resistant surface slope.	<6% medium salted		Sidewalk has dirt, not slip resistant.	ADAAG: 4.5.1 T24: 1133B.7.1.1	Provide a slip resistant surface medium salted finish when slope is <6%.	100	SF	8	\$800	C	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	C	

PRIORITY: C

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
-------------------	----------------------	-------------	-----------------------	-------------------	----------------------------	-----	--------------	--------------	---------------	----	--------------

331 30 South Lindan Ave.

\$3,000

Curb Ramps & Landings

Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None. Photo #: 5	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	C	
--	-----	--	---------------------	--------------------------------	--	---	-----	------	---------	---	--

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
----------------	-------------------	-------------	--------------------	----------------	-------------------------	-----	-----------	-----------	------------	----	-----------

Total Cost for Priority: D = \$518,408

Priority: D Quincy PUBLIC RIGHT-OF-WAY Site Cost = \$518,408

1 211 Alder Ct \$2,000

Curb Ramps & Landings

Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	
--	-----	--	--	--------------------------------	--	---	-----	------	---------	---	--

2 111 Alder St \$4,000

Walks and Sidewalks

Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope 6.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	500	SF	8	\$4,000	D	
--	-----------------------------------	--	----------------------------	----------------------------------	--	-----	----	---	---------	---	--

3 115 Alder St \$604

Curb Ramps & Landings

No broken/uneven surfaces.	Yes		Broken curb ramp needs to be patch.	ADAAG: 4.5.2 T24: 1127B.5.5	Remove asphalt or concrete and provide new smooth, stable and slip resistant surface. Contrasting finish with the adjacent sidewalks.	2	SF	22	\$44	D	
----------------------------	-----	--	-------------------------------------	--------------------------------	---	---	----	----	------	---	--

Walks and Sidewalks

Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	40	SF	14	\$560	D	
--	------	--	------------------	--------------------------------	--	----	----	----	-------	---	--

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
6 200 Alder St									\$6,660		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp is broken.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	D	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	520	SF	8	\$4,160	D	
7 211 Alder St									\$3,000		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
8 225 Alder St									\$4,000		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	
9 247 Alder St									\$2,880		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	360	SF	8	\$2,880	D	
10 322 Alder St									\$2,560		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	320	SF	8	\$2,560	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
11 329 Alder St									\$4,520		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	305	SF	14	\$4,270	D	
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is 30" wide due to the location of mailbox.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Move Mailbox	1	JOB	250	\$250	D	
12 332 Alder St									\$5,440		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 36" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	180	SF	8	\$1,440	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.5%. Photo #: 31	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	200	SF	8	\$1,600	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
13 337 Alder St									\$5,456		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 42" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	112	SF	8	\$896	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 19%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	320	SF	8	\$2,560	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
14 340 Alder St										\$6,520	
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	140	SF	14	\$1,960	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 4.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	320	SF	8	\$2,560	D	
15 10 Bradley St										\$2,400	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 4.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
24 40 Buchanan St										\$1,216	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.5% - 2.7%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	152	SF	8	\$1,216	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
29 20 Central Ave									\$8,080		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.2% - 5.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	470	SF	8	\$3,760	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	460	SF	8	\$3,680	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 6.3% - 6.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	80	SF	8	\$640	D	
32 50 Church St									\$2,656		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	332	SF	8	\$2,656	D	
34 116 Circle Dr									\$1,472		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	184	SF	8	\$1,472	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
35 110 Coburn St									\$1,600		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has uneven surfaces due to tree root upheave. Photo #: 13	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	200	SF	8	\$1,600	D	
36 125 Coburn St									\$7,192		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 2.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	320	SF	8	\$2,560	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 4.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	390	SF	8	\$3,120	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.7%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	189	SF	8	\$1,512	D	
37 130 Coburn St									\$3,120		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Replace with sidewalk.	90	SF	8	\$720	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3.6%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
38 144 Coburn St									\$8,148		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	260	SF	14	\$3,640	D	
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	322	SF	14	\$4,508	D	
39 153 Coburn St									\$5,832		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk. Photo #: 14	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	268	SF	14	\$3,752	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Broken driveway needs to be replaced.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	260	SF	8	\$2,080	D	
40 160 Coburn St									\$3,000		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
41 169 Coburn St									\$5,780		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Driveway has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	270	SF	14	\$3,780	D	
50 23 Crescent St									\$1,600		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.5% - 2.6%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	200	SF	8	\$1,600	D	
53 106 Crescent St									\$2,016		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.7%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	252	SF	8	\$2,016	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
69 390 East High St									\$9,840		
Detectable Warnings/Truncated Domes											
Where walk crosses or adjoins vehicular way not separated by curb, guard or handrails.	Yes		Sidewalk is flush with roadway.	ADAAG: 4.3.2 T24: 1133B.8.5	Modify street & sidewalk as needed to provide a raised sidewalk.	468	SF	20	\$9,360	D	
Detectable warnings width.	36".		Insufficient detectable warnings.	ADAAG: T24: 1133B.8.5	Replace detectable warnings.	1	JOB	480	\$480	D	
76 56 Harbison Ave									\$2,938		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	192	SF	14	\$2,688	D	
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a broken utility cover.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	1	JOB	150	\$150	D	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
-------------------	----------------------	-------------	-----------------------	-------------------	----------------------------	-----	--------------	--------------	---------------	----	--------------

78 88 Harbison Ave

\$1,400

Walks and Sidewalks

Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has uneven surfaces due to tree root upheave. Photo #: 6	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	126	SF	8	\$1,008	D	
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has a broken curb. Photo #: 6	ADAAG: 4.5.2 T24: 1133B.7.1	Replace broken curb.	28	LF	14	\$392	D	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
79 35 Jackson St									\$10,500		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top landing, it has a lip, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3.9%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	450	SF	8	\$3,600	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.0%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	175	SF	8	\$1,400	D	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
80 55 Jackson St									\$24,600		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.	Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500		D	
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.	Curb ramp has 17.1% flares, no detectable warnings and contrast with adjacent surfaces. Photo #: 4	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500		D	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)	Sidewalk is only 42" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	1800	SF	8	\$14,400		D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 3.5%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	400	SF	8	\$3,200		D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
105 240 Jackson St									\$1,800		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 2.7%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	225	SF	8	\$1,800	D	
107 269 Jackson St									\$2,624		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 2.6%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	328	SF	8	\$2,624	D	
123 420 Jackson St									\$3,000		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
125 470 Jackson St									\$7,148		
Curb Ramps & Landings											
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top or bottom landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 2.7%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	56	SF	8	\$448	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	400	SF	8	\$3,200	D	
128 514 Jackson St									\$1,456		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	104	SF	14	\$1,456	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
129 520 Jackson St									\$4,096		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	250	SF	8	\$2,000	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.7% - 3.5%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	262	SF	8	\$2,096	D	
132 542 Jackson St									\$1,920		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 4.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	240	SF	8	\$1,920	D	
133 554 Jackson St									\$1,920		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	240	SF	8	\$1,920	D	

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
----------------	-------------------	-------------	--------------------	----------------	-------------------------	-----	-----------	-----------	------------	----	-----------

134 563 Jackson St

\$4,664

Curb Ramps & Landings

Curb ramp finish complying with Section 1124B and Contrasting finish with adjacent sidewalk and detectable warning/truncated domes.	Curb ramp finish contrasting with adjacent sidewalk and detectable warnings shall contrast visually with adjoining surfaces, either light-on-dark, or dark-on-light with a 70% visual contrast.	Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.29.2 T24: 1127B.5.5 & 1127B.5.7	Provide curb ramp with contrasting finish from adjacent sidewalk, detectable warnings contrasting visually with adjoining surfaces either light-on-dark, or dark-on-light, when curb ramp is remodeled.	1	JOB	800	\$800	D
---	---	--	---	---	---	-----	-----	-------	---

Walks and Sidewalks

Smooth surface, no excessive irregular surfaces.	Yes.	Sidewalk has chipping concrete. Photo #: 19	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	276	SF	14	\$3,864	D
--	------	--	------------------------------------	--	-----	----	----	---------	---

135 570 Jackson St

\$3,520

Walks and Sidewalks

Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 6.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	260	SF	8	\$2,080	D
Cross slope.	Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 3.3%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	120	SF	8	\$960	D
Cross slope.	Cross slope shall be <2%.	Sidewalk has cross slope of 2.2% - 3.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	60	SF	8	\$480	D

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
136 573 Jackson St									\$4,000		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 3%		ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	500	SF	8	\$4,000	D	
137 583 Jackson St									\$1,000		
Curb Ramps & Landings											
Transition from curb ramps to walks, gutters or streets shall be flush and free of abrupt changes.	No curb ramp bottom landing lip allowed. Maximum slopes of adjoining gutters, road surface immediately adjacent to the curb ramp or accessible route shall not exceed 1 unit vertical to 20 units horizontal (5%) slope within 4 feet of the curb ramp bottom landing.	Curb ramp has a lip, no detectable warnings and contrast with adjacent surfaces. Photo #: 11		ADAAG: 4.7.2 T24: 1127B.5.3 & 1127B.5.5	Grind lip, provide new detectable warnings and contrasting color with adjacent surfaces.	1	JOB	1000	\$1,000	D	
138 586 Jackson St									\$4,576		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.	Sidewalk cross slope ranges from 3.2% - 5.2%.		ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	572	SF	8	\$4,576	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
139 590 Jackson St									\$4,984		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.	1	JOB	3000	\$3,000	D	
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 3.2% - 4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	248	SF	8	\$1,984	D	
141 603 Jackson St									\$3,500		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".		Multiple code requirements.	Curb ramp has 4% cross slope, no detectable warnings and contrast with adjacent surfaces..	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
142 610 Jackson St									\$5,000		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	220	SF	14	\$3,080	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		There is no driveway.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Provide a new driveway	240	SF	8	\$1,920	D	
143 618 Jackson St									\$4,800		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		None.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	200	SF	14	\$2,800	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
145 122 Lawrence St									\$7,660		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp 36" wide, it has a lip, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	520	SF	8	\$4,160	D	
146 124 Lawrence St									\$100		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 24" wide due to the location of vegetation. Photo #: 28	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	D	
147 134 Lawrence St									\$2,560		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3.4%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	320	SF	8	\$2,560	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
150 162 Lawrence St									\$9,048		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has multiple patches.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	260	SF	14	\$3,640	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	600	SF	8	\$4,800	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.6% - 2.7%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	76	SF	8	\$608	D	
151 170 Lawrence St									\$3,040		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	380	SF	8	\$3,040	D	
153 176 Lawrence St									\$1,344		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 5.1%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	168	SF	8	\$1,344	D	
154 179 Lawrence St									\$288		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 2.6%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	36	SF	8	\$288	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
155 184 Lawrence St									\$4,544		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	48	SF	8	\$384	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	520	SF	8	\$4,160	D	
156 192 Lawrence St									\$6,228		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Replace with sidewalk.	81	SF	8	\$648	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	260	SF	8	\$2,080	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
160 237 Lawrence St									\$5,360		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 2.7%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	670	SF	8	\$5,360	D	
166 307 Lawrence St									\$2,900		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 31" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 2.7%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	350	SF	8	\$2,800	D	
168 317 Lawrence St									\$100		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 25" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
170 333 Lawrence St									\$6,180		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	460	SF	8	\$3,680	D	
172 355 Lawrence St									\$5,184		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.7%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	158	SF	8	\$1,264	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 3.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	490	SF	8	\$3,920	D	
174 381 Lawrence St									\$100		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
175 391 Lawrence St									\$3,700		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 30" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	D	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 12" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
177 411 Lawrence St									\$3,600		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	D	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
179 437 Lawrence St									\$4,496		
Curb Ramps & Landings											
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top or bottom landing, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 30" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 3.2%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	112	SF	8	\$896	D	

181 465 Lawrence St **\$3,500**

Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
183 491 Lawrence St									\$4,732		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.	Curb ramp flare is 14.9% slope.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D		
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with	Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800	D		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway flare has 20.2% slope.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	27	SF	8	\$216	D		
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway flare has 16.1% slope.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	27	SF	8	\$216	D		

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
202 102 Main St									\$5,570		
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a broken utility cover.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	1	JOB	150	\$150	D	
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a broken utility cover.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	1	JOB	150	\$150	D	
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a broken utility cover.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	1	JOB	150	\$150	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	480	SF	8	\$3,840	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.9%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	160	SF	8	\$1,280	D	

203 110 Main St **\$1,408**

Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 5.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	176	SF	8	\$1,408	D	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
204 116 Main St									\$6,224		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 4.3% - 4.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	58	SF	8	\$464	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	420	SF	8	\$3,360	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
205 121 Main St									\$4,520		
Curb Ramps & Landings											
Detectable warnings and contrast with adjacent surfaces at existing curb ramps.	Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with		Curb ramp does not have detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A	Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.	1	JOB	800	\$800	D	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 4.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	75	SF	8	\$600	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 7.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	390	SF	8	\$3,120	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
207 128 Main St									\$3,552		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.8% - 3.2%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	144	SF	8	\$1,152	D	
208 129 Main St									\$3,880		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	185	SF	8	\$1,480	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
209 132 Main St									\$4,282		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	D	
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a broken utility cover.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	1	JOB	150	\$150	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.9% - 5.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	204	SF	8	\$1,632	D	
210 139 Main St									\$2,000		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 3.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	250	SF	8	\$2,000	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
211 140 Main St									\$6,400		
Curb Ramps & Landings											
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top landing, it has a lip, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Walks and Sidewalks											
Pavement dislocations, uneven surface - due to utility cover.	Vertical change with beveled edge 1:2 max. (between 1/4" and 1/2")		Sidewalk has a broken utility cover. Photo #: 2	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or adjust underground utility cover as required to provide smooth and even surface. Contact appropriate agency to notify and coordinate barrier removal.	1	JOB	500	\$500	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.3% - 3.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
212 145 Main St									\$5,120		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	280	SF	8	\$2,240	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	360	SF	8	\$2,880	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
213 150 Main St									\$2,752		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.8% - 3.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	44	SF	8	\$352	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
214 153 Main St									\$4,180		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.0%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	220	SF	8	\$1,760	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Sidewalk has a 8.7% cross slope.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	290	SF	8	\$2,320	D	
215 162 Main St									\$1,760		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.5% - 3.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	220	SF	8	\$1,760	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
216 172 Main St									\$4,332		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	138	SF	14	\$1,932	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 13.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
217 175 Main St									\$5,466		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	95	SF	14	\$1,330	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	207	SF	8	\$1,656	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Replace with sidewalk.	100	SF	8	\$800	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	210	SF	8	\$1,680	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
218 180 Main St									\$3,800		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.6% - 4.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	75	SF	8	\$600	D	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 10.%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 3.0%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	100	SF	8	\$800	D	
219 183 Main St									\$1,600		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 11.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	200	SF	8	\$1,600	D	
220 189 Main St									\$3,040		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 12.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	290	SF	8	\$2,320	D	
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 3.1% - 3.2%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	90	SF	8	\$720	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
221 192 Main St									\$2,788		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	D	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 5.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	36	SF	8	\$288	D	
222 197 Main St									\$3,500		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
223 204 Main St									\$3,620		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.	Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500		D	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 4.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	140	SF	8	\$1,120		D	
224 214 Main St									\$2,688		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 11.8%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400		D	
Cross slope.	Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.3% - 3.7%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	36	SF	8	\$288		D	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
228 268 Main St									\$5,548		
Curb Ramps & Landings											
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top or bottom landing, it has a lip, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.7% - 3.0%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	176	SF	8	\$1,408	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.4%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	80	SF	8	\$640	D	
241 345 Main St									\$512		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.7%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	64	SF	8	\$512	D	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
245 59 South Lindan Ave									\$6,878		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has uneven surfaces.	ADAAG: 4.5.2 T24: 1133B.7.1	Patch existing concrete to provide smooth accessible route surface.	1	JOB	50	\$50	D	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 42" wide.	ADAAG: 4.3.3 T24: 1133B.7.1	Enlarge width of walk/sidewalk/pedestrian way to 48" when area is remodeled. (CA only)	416	SF	8	\$3,328	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
246 60 South Lindan Ave									\$5,000		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top or bottom landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.0%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	150	SF	8	\$1,200	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.2%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Raise sign.	1	JOB	300	\$300	D	
247 339 Stephan Way									\$3,424		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	176	SF	14	\$2,464	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 6.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	120	SF	8	\$960	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
248 355 Stephan Way									\$100		
Walks and Sidewalks											
Smooth surface, no irregular surfaces or gaps.	Gaps no more than 1/2" in the direction of travel.		Sidewalk has a 3" gap.	ADAAG: 4.5.2 T24: 1133B7.1	Fill in gap or hole to provide smooth surface.	2	SF	50	\$100	D	
249 360 Stephan Way									\$3,760		
Curb Ramps & Landings											
Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.	Yes		Curb ramp running slope is 9.7%.	ADAAG: 4.7.1 T24: 1127B.5.1	Provide new "Case C" curb ramp, including "No parking zone" red paint at both sides of depressed curb-ramp and detectable warnings. Coordinate location with Traffic Engineer for safety conditions.	1	JOB	2000	\$2,000	D	
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Sidewalk has broken concrete.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	220	SF	8	\$1,760	D	
251 380 Stephan Way									\$2,520		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	180	SF	14	\$2,520	D	
252 390 Stephan Way									\$3,360		
Walks and Sidewalks											
Smooth surface, no excessive irregular surfaces.	Yes.		Broken sidewalk.	ADAAG: 4.5.2 T24: 1133B.7.1	Remove and replace existing concrete sidewalk.	240	SF	14	\$3,360	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
253 391 Stephan Way									\$100		
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 24" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	D	
255 570 West Main St									\$800		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 2.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	100	SF	8	\$800	D	
285 2116 East Main St									\$5,900		
Curb Ramps & Landings											
Diagonal curb ramp with flared sides - "Case E".	Multiple code requirements.		Curb ramp does not have top landing, 17% flares, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5.9	Remove existing "Case E". diagonal curb ramp and provide new compliant curb ramp with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
286 2130 East Main St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
290 2190 East Main St									\$3,690		
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of mailbox.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Move mailbox.	1	JOB	250	\$250	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	430	SF	8	\$3,440	D	
292 2206 East Main St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 12.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
293 2216 East Main St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
295 2228 East Main St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
297 2248 East Main St									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 13.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
298 2254 East Main St									\$2,528		
Walks and Sidewalks											
Pavement dislocations, changes in level.	Beveled edge 1:2 max. (between 1/4" and 1/2").		Sidewalk has a 1/2" lip.	ADAAG: 4.5.2 T24: 1133B.7.4	Remove, replace or repair surface area to correct abrupt change in level.	16	SF	8	\$128	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
299 2266 East Main St									\$3,048		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Replace with sidewalk.	81	SF	8	\$648	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
300 2288 East Main St									\$6,150		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of mailbox.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Move mail box.	1	JOB	250	\$250	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
302 2308 East Main St									\$3,500		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces, it has a lip, and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
304 2316 East Main St									\$2,650		
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of mailbox.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Move mailbox.	1	JOB	250	\$250	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
305 2320 East Main St									\$7,600		
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is only 24" wide to utility pole.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Relocate utility pole to provide required minimum clear path of travel.	1	JOB	5000	\$5,000	D	
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is only 30" wide due to the location of mailbox.	ADAAG: 4.3.3 T24: 1133B.7.1	Relocate mailbox.	1	JOB	200	\$200	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
306 2328 East Main St									\$7,750		
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is only 24" wide.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Relocate utility pole to provide required minimum clear path of travel.	1	JOB	5000	\$5,000	D	
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is 31" wide due to the location of mailbox. Photo #: 17	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Move mailbox.	1	JOB	350	\$350	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 12.5%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
308 2336 East Main St									\$4,800		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.8%. Photo #: 3	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
312 7 Fairgrounds Rd									\$6,624		
Walks and Sidewalks											
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 3.1%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	48	SF	8	\$384	D	
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 9.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	600	SF	8	\$4,800	D	
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.5% - 3.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	180	SF	8	\$1,440	D	

313 43 Fairgrounds Rd									\$3,920		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.		<2%, (2.5% not to exceed 20 L.F.)	Driveway cross slope is 10.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	370	SF	8	\$2,960	D	
Cross slope.		Cross slope shall be <2%.	Sidewalk cross slope ranges from 2.2% - 3.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	120	SF	8	\$960	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
315 65 Fairgrounds Rd									\$4,672		
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.9%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	184	SF	8	\$1,472	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	400	SF	8	\$3,200	D	
316 79 Fairgrounds Rd									\$3,520		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	220	SF	8	\$1,760	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 4.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	120	SF	8	\$960	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 10.6%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Replace with sidewalk.	100	SF	8	\$800	D	

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
317 93 Fairgrounds Rd									\$4,964		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case C".	Multiple code requirements.		Curb ramp is 24" wide, no detectable warnings and contrast with adjacent surfaces.	ADAAG: 4.7 T24: 1127B.5	Remove existing corner curb ramp "Case C" and provide new compliant curb ramp aligned with path of travel, including "No-parking zone" red striping at each side of curb ramp and detectable warnings.	1	JOB	2500	\$2,500	D	
Walks and Sidewalks											
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.5%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	88	SF	8	\$704	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.6%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	220	SF	8	\$1,760	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
319 111 Fairgrounds Rd									\$4,350		
Curb Ramps & Landings											
Existing curb ramp with multiple code non-compliances - "Case E".	Multiple code requirements.		Curb ramp has multiple non-compliances, no detectable warnings and contrasting color with adjacent surfaces and no top landing.	ADAAG: 4.7 T24: 1127B.5	Remove existing curb ramp and provide new "Case E" curb ramp, with the required slopes, top and bottom landings, 12" grooves, detectable warnings, contrasting color with adjacent surfaces and "No-parking zone" red striping at each side of curb ramp.	1	JOB	3500	\$3,500	D	
Hazards/Protruding Objects											
Guy supports, slanted utility guy wire adjacent to path of travel.	80" high clearance above finished floor min.		Sidewalk is only 46" wide due to the location of utility anchor.	ADAAG: 4.4.2 T24: 1133B.8.6.1	Provide guy brace to obtain required 80" height clearance from walkway surface.	1	JOB	750	\$750	D	
Walks and Sidewalks											
Walk/sidewalk width.	36" ADA, 48" min. (CA only)		Sidewalk is 30" wide due to the location of vegetation.	ADAAG: 4.3.3 T24: 1133B.7.1	Trim vegetation to provide the required sidewalk width.	1	JOB	100	\$100	D	
320 113 Fairgrounds Rd									\$4,896		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	560	SF	8	\$4,480	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 2.2% - 3.3%	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	52	SF	8	\$416	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
321 125 Fairgrounds Rd									\$4,000		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.9%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	500	SF	8	\$4,000	D	
322 143 Fairgrounds Rd									\$2,880		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	360	SF	8	\$2,880	D	
323 147 Fairgrounds Rd									\$2,400		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	300	SF	8	\$2,400	D	
324 153 Fairgrounds Rd									\$2,160		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 9.2%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	270	SF	8	\$2,160	D	
325 167 Fairgrounds Rd									\$2,480		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.4%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	310	SF	8	\$2,480	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
326 171 Fairgrounds Rd									\$3,620		
Walks and Sidewalks											
Provide clear width of accessible path of travel at sidewalk.	36" ADA, 48" min. (CA only)		Sidewalk is 36" wide due to the location of rocks.	ADAAG: 4.3.3 T24: 1133B.7.1.3 Exception	Move rocks.	1	JOB	100	\$100	D	
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 8.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	340	SF	8	\$2,720	D	
Cross slope.	Cross slope shall be <2%.		Sidewalk cross slope ranges from 3.6% - 4.3%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify walk/sidewalk/pedestrian way to provide compliant cross slope.	100	SF	8	\$800	D	

327 183 Fairgrounds Rd									\$2,080		
Walks and Sidewalks											
Cross slope at intersection of walkway and driveway.	<2%, (2.5% not to exceed 20 L.F.)		Driveway cross slope is 11.7%.	ADAAG: 4.3.7 T24: 1133B.7.1.3	Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.	260	SF	8	\$2,080	D	

PRIORITY: D

31-Mar-11

ITEM/ LOCATION	CONDITION BARRIER	REQUIREMENT	EXISTING CONDITION	CODE REFERENCE	SUGGESTED RECOMMENDATIO	QTY	UNIT TYPE	UNIT COST	TOTAL COST	PR	IMPL DATE
-------------------	----------------------	-------------	-----------------------	-------------------	----------------------------	-----	--------------	--------------	---------------	----	--------------

328 193 Fairgrounds Rd

\$3,040

Curb Ramps & Landings

<p>Detectable warnings and contrast with adjacent surfaces at existing curb ramps.</p>	<p>Detectable warnings at existing curb ramps. Retrofit required if built before or after the suspension period from 1,994 until July 21 of 2,001. Older curb ramps to be part of a Transition Plan. Curb ramp shall contrast with</p>	<p>Curb ramp does not have detectable warnings and contrast with adjacent surfaces.</p>	<p>ADAAG: 4.7.2 T24: 1127B.5.7; Fig. 11B-23A</p>	<p>Provide in-line detectable warnings at curb ramp and contrast with adjacent surfaces.</p>	1	JOB	800	\$800	D
--	--	---	---	--	---	-----	-----	-------	---

Walks and Sidewalks

<p>Cross slope at intersection of walkway and driveway.</p>	<p><2%, (2.5% not to exceed 20 L.F.)</p>	<p>Driveway cross slope is 11.7%.</p>	<p>ADAAG: 4.3.7 T24: 1133B.7.1.3</p>	<p>Modify driveway and walk/sidewalk/pedestrian way to provide compliant cross slope.</p>	280	SF	8	\$2,240	D
---	---	---------------------------------------	---	---	-----	----	---	---------	---

332 14 Mill Creek Rd

\$3,000

Curb Ramps & Landings

<p>Curb ramp required at each corner of street intersections and where a pedestrian way crosses a curb.</p>	<p>Yes</p>	<p>None. Photo #: 29</p>	<p>ADAAG: 4.7.1 T24: 1127B.5.1</p>	<p>Provide new "Case E" curb ramp, including "No parking zone" red paint at both sides of curb-ramp and detectable warnings. (Preferred placement in center of crosswalk within marked crossings). Coordinate location with Traffic Engineer for safety conditions.</p>	1	JOB	3000	\$3,000	D
---	------------	-----------------------------------	---	---	---	-----	------	---------	---

Total Project Cost : \$1,740,033