

Found Monuments

- 1 1/19 Fd DIBC
- 2 1/24 cc Fd DIBC  
Set 3/4" I.P.L.S. 3621 on Range line
- 3 1/19 Fd DIBC
- 4 1/16 cor Fd 3/4" I.P.L.S. 2322
- 5 1/30 Fd DIBC
- 6 2/25 cc Fd DIBC  
Set 3/4" I.P.L.S. 3621 on Range line
- 7 1/4 30 Fd DIBC.
- 8 1/30 31 Fd DIBC
- 9 2/25 cc Fd DIBC  
Set 3/4" I.P.L.S. 3621 on Range line
- 10 1/4 31 Fd DIBC
- 11 1/24 Fd DIBC this monument  
is marked C.C. ~ G.L.O. notes  
Indicate that it is not a C.C.
- 12 3/6 1 Fd DIBC
- 13 1/4 1/16 Fd DIBC
- 14 1/4 2/24 Fd 3/4" I.P.L.S. 2322  
by marked stone  
G.L.O.-B.T. 44" pine S66°W 17'
- 15 1/4 23+24 Fd 3/4" I.P.L.S. 2322  
by marked stone  
G.L.O.-B.T.'s 42" fir N40°E 24'  
19" fir N80°W 55'
- 16 1/4 2/25 Fd 3/4" I.P.L.S. 2322  
f.R.P. 6" cedar S79°W 21'  
G.L.O.-B.T. 25" pine N32°E 29'
- 17 E 1/6 2/25 Fd 3/4" I.P.L.S. 2322  
f.R.P. 23" cedar S 58°W 33'
- 18 1/4 26+25 Fd 3/4" I.P.L.S. 2322  
G.L.O.-B.T.'s 23" fir N41°W 9'  
23" fir S45°E 13'
- 19 1/4 2/25 Fd 3/4" I.P.L.S. 2322  
by marked stone  
f.R.P. 22" fir S24°E 30'  
G.L.O.-B.T.'s 42" fir N9°W 25'  
down pine SE 20±

Corner Data

- A C 1/4 Section 24  
Scribed 15" W Fir S 27°E 25"  
13" W Fir N 22°E 24"
- B C.E. 1/6 Section 24  
Scribed 8" Fir S 18°W 21"
- C E 1/4 Section 24  
Scribed 6" Fir N 16°W 13"  
12" Fir S 24°W 16"
- D S.E. 1/6 Section 24  
Scribed 22" Y Pine S 8°W 17"
- E C.E. 1/6 Section 25  
Scribed 8" Fir S 43°E 9"  
13" Fir S 74°W 12"
- F E 1/4 Section 25  
Scribed 17" Fir N 30°W 8"  
10" Fir S 8°W 18"
- G C.S. 1/6 Section 25  
Scribed 13" Fir N 49°W 4"  
17" Fir S 32°E 16"

LEGEND

- o Monument found
- Monument set ~ 3/4" I.P.L.S. 3621  
D.I.B.C. Dept of Interior Brass Cap - set  
by USFS & B.L.M. in 1968
- ( ) Data from G.L.O. notes
- Property line blazed
- CC = Closing Corner

NOTES

1. Bearings are from solar taken @  
the corner to 25/36
2. Mag bearings shown on B.T.'s & R.P.'s


Corner Data

- H S.E. 1/6 Section 25  
Scribed 12" Cedar S 25°E 26"  
21" S Pine S 28°W 25"
- I S 1/6 25'  
Scribed 6" Cedar N 28°W 13"  
8" Y Pine S 22°W 30"
- J E 1/6 25/36  
Scribed 24" Cedar N 22°E 8"  
9" Fir S 22°W 24"

**SURVEYOR'S CERTIFICATE**

THIS MAP CORRECTLY REPRESENTS A SURVEY MADE BY ME OR UNDER MY DIRECTION IN CONFORMANCE WITH THE REQUIREMENTS OF THE LAND SURVEYORS ACT IN July & Aug 1975 AT THE REQUEST OF USFS & CROCKER NATIONAL BANK

*Rodney D Dawson*  
RODNEY D DAWSON L.S. 3621

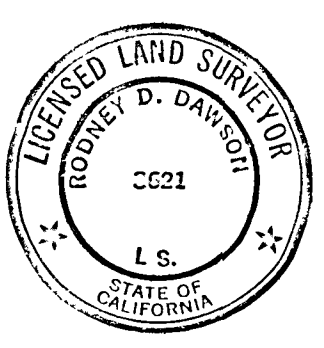

**COUNTY SURVEYOR'S CERTIFICATE**

THIS MAP HAS BEEN EXAMINED THIS 11<sup>th</sup> DAY OF November 1975 FOR CONFORMANCE WITH THE REQUIREMENTS OF THE LAND SURVEYOR'S ACT.

COUNTY SURVEYOR *Samuel J. Felt*

DEPUTY \_\_\_\_\_

**RECORDER'S CERTIFICATE**

FILED THIS 11<sup>th</sup> DAY OF November 1975 AT 9:40 A.M. IN BOOK 4 OF Records of Surveys AT PAGE 91 AT THE REQUEST OF County Engineer

FILE NO. \_\_\_\_\_

COUNTY RECORDER *Dorothy New Masley*

DEPUTY *Lana A. Brown*

**RECORD OF SURVEY**

CERTAIN LINE IN SECTIONS 24, 25, & 36; T28N, R10E M.D.M.; COUNTY OF PLUMAS; STATE OF CALIFORNIA

FOR: SYLVAN FORESTS (CROCKER NATIONAL BANK) & THE PLUMAS NATIONAL FOREST

RODNEY D DAWSON ~ SURVEYOR AUG 1975