

<p>C C S9 MS 1238</p> <p>CORNER No. 1 SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM ROD. CORNER FALLS IN A TIMBERED FLAT.</p> <p>SCRIBED A 17" WHITE FIR, S38°W, 12.6" "S9 BT" SCRIBED A 19" WHITE FIR, S65°E, 23.0' "MS 1238 BT"</p>		<p>LP NO 1 CORNER No. 8 1965 LS 3079 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1). CORNER FALLS ON A SOUTHWEST RIDGE, 10°± NORTH OF A TRAIL AND UNDERGROUND PHONE LINE.</p> <p>FD. A 14" INCENSE CEDAR, S27°E, 23.3' REC. A 10" CEDAR, S25°E, 23.1' (1) SCRIBED AN 11" INCENSE CEDAR, S82°E, 17.2' "X BT"</p>	<p>CORNER NOTES</p> <p>HB = HEALED BLAZE VS = VISIBLE SCRIBING (1) = RECORD PER 3 RS 52 (2) = RECORD PER MINERAL SURVEY PLAT #1238 (3) = RECORD PER 8 RS 149</p>	
<p>BMSW CORNER No. 2 LS 3079 1965 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1). CORNER FALLS 30°± SOUTHWEST OF A ROAD.</p> <p>FD. A 27" PONDEROSA PINE, N48°W, 17.0' -HB REC. A 24" PINE, N57°W, 16.5' (1) SCRIBED A 12" TAMARACK, S63°W, 20.3' "BMSW BT"</p>		<p>BALD MTN PM T21N R9E CORNER No. 9 LP EB SE SW 1964 LS 3079 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1) IN A MOUND OF STONE. CORNER FALLS ON A SOUTHWEST RIDGE, 10°± NORTH OF A TRAIL AND UNDERGROUND PHONE LINE.</p> <p>SCRIBED A 14" INCENSE CEDAR, S68°E, 20.1' "EBSW MS1238 BT" SCRIBED AN 11" WHITE FIR, S10°W, 19.1' "LPSE MS1238 BT"</p>	<p>T21N R9E 1/4 S9 S10 LS 3966 2001 CORNER No. 15 NO EVIDENCE FOUND. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM ROD IN A MOUND OF STONE. CORNER FALLS IN A SKID ROAD ON A MODERATE SOUTH SLOPE IN AN AREA OF HEAVY LOGGING.</p> <p>SCRIBED AN 8" WHITE FIR, N78°W, 27.3' "1/4 S9 BT" SCRIBED A 10" INCENSE CEDAR, N28°E, 23.5' "1/4 S10 BT"</p>	
<p>BM NO 2 CORNER No. 3 LS 3079 1965 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1) IN A MOUND OF STONE. CORNER FALLS ON A GENTLE SOUTHWEST SLOPE, 20°± NORTH OF A TRAIL AND UNDERGROUND PHONE LINE.</p> <p>FD. A 39" INCENSE CEDAR, N72°E, 2.0' REC. A 40" CEDAR, N58°31'E, 1.4' (1) FD. A 22" WHITE FIR SNAG, S83°W, 31.2' REC. A 12" WHITE FIR, S80°15'W, 29.5' (1) SCRIBED A 19" INCENSE CEDAR, N86°W, 44.4' "BM2 MS1238 BT"</p>		<p>EB NO 2 CORNER No. 10 1965 LS 3079 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1) IN A MOUND OF STONE. CORNER FALLS ON A SOUTHWEST RIDGE, 30°± NORTH OF A TRAIL AND UNDERGROUND PHONE LINE.</p> <p>FD. A 30" PONDEROSA PINE, S33°E, 2.1' REC. A 30" PINE, S28°45'E, 1.1' (1) SCRIBED AN 11" WHITE FIR, N67°W, 23.0' "EB2 MS1238 BT"</p>	<p>BMNW CORNER No. 16 LS 3079 1965 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1) IN A MOUND OF STONE. CORNER FALLS 20°± NORTH OF A LOGGING ROAD.</p> <p>FD. A BOULDER, N78°W, 104.5' REC. A LARGE BOULDER, N78°45'W, 104' (1) FD. A 15" PINE, N87°E, 17.2' -HB REC. A 10" PINE, N88°30'E, 17.5' (1)</p>	
<p>BALD MTN PM T21N R9E CORNER No. 4 BM LP SE SW 1964 LS 3079 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1) IN A MOUND OF STONE. CORNER FALLS ON A FLAT SOUTHWEST RIDGE, 30°± NORTH OF A TRAIL AND UNDERGROUND PHONE LINE.</p> <p>SCRIBED A 18" INCENSE CEDAR, WEST, 26.5' "BMSW MS1238 BT" CEDAR STUMP PER (1) NOT FD.</p>		<p>EB NO 1 CORNER No. 11 1965 LS 3079 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1). PIPE IS BENT BUT BURIED TO FULL LENGTH - TIED AS IS. CORNER FALLS 20°± NORTH OF A TRAIL AND UNDERGROUND PHONE LINE.</p> <p>FD. A 13" WHITE FIR, N25°W, 20.1' -VS REC. A 7" WHITE FIR, N35°E, 9.25' (1) SCRIBED A 12" WHITE FIR, N67°W, 30.2' "EB1 MS1238 BT"</p>	<p>CORNER No. 18 FD. A 16 X 12 X 14 INCH STONE, 4 NOTCHES SOUTH, 3 NOTCHES EAST IN A 3.5' DIAMETER MOUND OF STONE. (2) CORNER FALLS ON A SMALL FLAT IN HEAVY TIMBER.</p> <p>FD. A 21" CEDAR SNAG, S58°W, 17.8' -VS REC. A 20" CEDAR, S60°W, 17.8' (1) FD. A 45" FIR SNAG, N17°W, 79.2' -VS REC. A 40" FIR, N5°W, 79.2' (1) 6" CEDAR PER (2) NOT FD.</p>	
<p>LP NO 4 CORNER No. 5 1965 LS 3079 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1) IN A MOUND OF STONE. CORNER FALLS ON A FLAT SOUTHWEST RIDGE, 30°± NORTH OF A TRAIL AND UNDERGROUND PHONE LINE.</p> <p>FD. A 20" INCENSE CEDAR, N44°E, 30.4' REC. A 12" CEDAR, N45°02'E, 29.9' (1)</p>		<p>EBSE ELSW CORNER No. 12 1965 LS 3079 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1). CORNER FALLS 20°± NORTH OF A TRAIL AND UNDERGROUND PHONE LINE.</p> <p>SCRIBED A 12" WHITE FIR, S61°E, 30.7' "X BT" SCRIBED A 7" WHITE FIR, N51°E, 20.3' "ELSW BT" WHITE FIR PER (1) NOT FD.</p>	<p>CAP MARKED IMPROPERLY</p> <p>T21N R9E CORNER No. 19 9 10 16 15 LS 3079 FD. A 3/4" IRON PIPE WITH A 1" CAP. MARKED STONE PER (2) NOT FD. CORNER FALLS ON A MODERATE NORTH SLOPE, 120°± NORTH OF AN EAST-WEST ROAD.</p> <p>FD. A 32" WHITE FIR, S81°W, 46.2' -HB REC. A 13.5" WHITE FIR, S81°W, 47.5' (1) 18" FIR PER (2) NOT FD. 4" FIR PER (2) NOT FD. 30" FIR PER (2) NOT FD.</p>	
<p>LP NO 3 CORNER No. 6 1965 LS 3079 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1) IN A MOUND OF STONE. CORNER FALLS ON A FLAT SOUTHWEST RIDGE, 20°± NORTH OF A TRAIL AND UNDERGROUND PHONE LINE.</p> <p>SCRIBED A 16" INCENSE CEDAR, N49°E, 11.3' "LP3 BT" SCRIBED A 13" PONDEROSA PINE, S2°W, 28.0' "LP3 MS1238 BT" CEDAR PER (1) NOT FD.</p>		<p>E-SE CORNER No. 13 1965 LS 3079 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1). CORNER FALLS 20°± NORTH OF A TRAIL AND UNDERGROUND PHONE LINE.</p> <p>FD. A 25" RED FIR, S66°W, 13.0' REC. A 10" WHITE FIR, S65°32'W, 12.5' (1) FD. A 33" RED FIR, N19°E, 15.2' NO RECORD FOUND</p>		
<p>LP NO 2 CORNER No. 7 1965 LS 3079 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1) IN A MOUND OF STONE. CORNER FALLS ON A FLAT SOUTHWEST RIDGE AT THE SOUTH EDGE OF A TRAIL AND UNDERGROUND PHONE LINE.</p> <p>FD. A 29" PONDEROSA PINE, N71°E, 18.8' REC. A 20" WHITE FIR, N74°48'E, 18.7' (1) SCRIBED AN 8" WHITE FIR, S30°E, 37.0' "LP2 MS1238 BT"</p>		<p>BMEC SWC CORNER No. 14 1965 LS 3079 FD. A 2" BRASS CAP IN A 2" IRON PIPE PER (1) IN A MOUND OF STONE. CORNER FALLS ON A FLAT, 30°± SOUTH OF A RAVINE.</p> <p>FD. A 19" WHITE FIR, N39°W, 10.7' -HB NO REC. FOUND FD. A 12" INCENSE CEDAR, N12°W, 25.7' -HB (CUT DOWN) REC. AN 8" INCENSE CEDAR, N4°W, 26.0' (1)</p>	<p>T21N R9E 1/4 S8 S9 LS 4790 1989 CORNER No. 20 FD. A 3 1/4" USFS ALUM. CAP ON A 2" ALUM PIPE ON A MOUND OF STONE PER (4). CORNER FALLS IN A LARGE TAILINGS PILE.</p> <p>FD. A 14" INCENSE CEDAR, N57°W, 25.8' -VS REC. A 13" CEDAR, N57°W, 25.8' (1) FD. AN 11" PONDEROSA PINE, N30°E, 41.6' -HB REC. A 9" PONDEROSA PINE, N30°E, 41.6' (1)</p>	


RECORD OF SURVEY

FOR

USDA FOREST SERVICE
PLUMAS NATIONAL FOREST

"UPPER SLATE 2"

IN SECTIONS 9, 10 AND 16,
T 21 N, R 9 E, MDM,
IN THE UNINCORPORATED AREA OF
PLUMAS COUNTY,
STATE OF CALIFORNIA

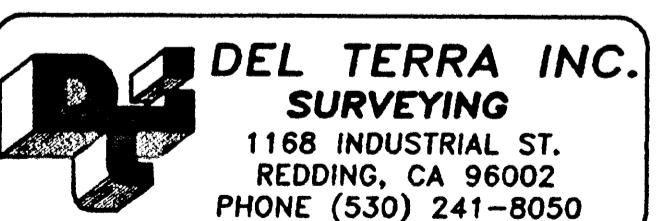

DATE: AUGUST, 2001

SHEET 2 OF 2