

T20N R8E
S8 | S9
S17 | S16
CORNER NO. 37

LS 3966 1990
FD. DEAD, DOWN, & ROTTEN OAK WITH AXE MARKS.
REC. 20" B. OAK TREE CORNER.
SET STD. MON IN STUMP HOLE.

FD. DEAD, DOWN, & ROTTEN OAK N48°E 19.8'
REC. 22" B. OAK N48°E 19.8' (GLO)
FD. DEAD OAK S2°W 28.4' V.S.
REC. 20" B. OAK S2°W 28.4' (GLO)
A 11" D. FIR S63°W 20.2' S.B.T.
A 16" D. FIR N67°30'E 8.4' S.B.T.
A 6" D. FIR N45°W 12.0' S.B.T.
A 7" D. FIR S167°E 24.1' S.B.T.

T20N 1/4
S13 | S18
R7E | R8E
CORNER NO. 38

LS 3966 1990
SET STD. MON IN STONE MOUND.
COR. FALLS ON SOUTH SLOPE.
POSITION BY DISTANCE-DISTANCE INTERSECT FROM FOUND BT & FD. LINE TREE STUMP

FD. 54" CEDAR N45°43'E, 35.6'
REC. 26" CEDAR N37°E, 35.6' (GLO BT)
FD. 64" W. FIR STUMP N0°12'E, 29.0'
REC. 56" FIR NORTH 29.0' (GLO LINE TREE)
A 7" TAN OAK N54°25'W 11.9' S.B.T.
A 8" TAN OAK N38°E 24.3' S.B.T.

T20N R8E
C 1/4 S18
LS 3966 1990
CORNER NO. 39

SET STD. MON IN STONE MOUND.
CORNER FALLS ±100' NORTH OF ROAD 22 N 24 IN TIMBER WITH BRUSHY UNDERGROWTH.

A 14" D. FIR S67°E 17.4' S.B.T.
A 12" CEDAR N2°W 21.8' S.B.T.

T20N R8E 1/4
S18 | S17
LS 3966 1990
CORNER NO. 40

SET STD. MON IN STONE MOUND.
COR. FALLS ON SLIGHT SOUTH SLOPE
POSITION BY SINGLE PROPORTION.
ON SMALL SW RIDGE, S25°E 500'± OF A LOGGING ROAD ±1000' NORTH OF SLY CREEK RESERVIOR.

A 18" B. OAK S70°30'W 36.6' S.B.T.
A 17" B. OAK S42°E 19.7' S.B.T.

T20N R8E
S13 | S18
S24 | S19
USFS 1943
CORNER NO. 41

FD. 2" CAPPED GALV. PIPE IN STONE MOUND.
CORNER IS 100'± EAST OF LANDING AT THE END OF A N/S ROAD ON EAST SLOPE IN HEAVY BRUSH.

FD. 45" W. FIR N70°W 66.3' H.B.
REC. 24" FIR N73°W 66.0' (FS)
A 8" Y. PINE S33°E 22.4' S.B.T.
A 18" CEDAR N20°W 3.5' S.B.T.
A 10" CEDAR N46°E 16.3' S.B.T.

1/4 S18
S19
USFS 1943
CORNER NO. 42

FD. 2" IP WITH 3 1/4" CAP

FD. DEAD AND DOWN OAK SNAG S26°E 23.0'
REC. 30" FALLEN OAK S27°E, 21.1' (FS)
REC. 26" B. OAK S26°E 23.1' (GLO)
FD. ROTTEN FIR STUMP N50°E 20.0'
REC. 28" D. FIR N50°30'E, 19.8' (FS)
REC. 22" SPRUCE N50°E 18.5' (GLO)
A 16" CEDAR N36°E 30.5' S.B.T.
A 10" W. FIR S31°15'E 24.2' S.B.T.

E 1/16 S18
S19
LS 3966 1990
CORNER NO. 43

SET STD. MON IN STONE MOUND.
COR. FALLS ON WEST SLOPE, 35'± EAST OF A N/S CREEK.

A 32" CEDAR N25°E 10.8' S.B.T.
A 12" W. FIR N43°W 7.8' S.B.T.

1/4 S17
S20
USFS 1943
CORNER NO. 44

FD. 1 1/4" IP WITH 2" CAP.

FD. 42" W. FIR S18°E 54.1' H.B.
REC. 36" FIR S18°E 54.1' (GLO)
FIRD. 35" FIR SNAG N12°E 31.0' H.B.
REC. 30" FIR N12°15'E 31.0' (GLO)
A 6" W. FIR N24°W 8.8' S.B.T.

CORNER NOTES

H.B. = HEALED BLAZE V.S. = VISIBLE SCRIBING
S.B.T. = SCRIBED AS A BEARING TREE
STD. MON = 3 1/4" USFS ALUM. CAP ON A 5/8" ROD
STD. BLM MON = 3 1/4" STAMPED BRASS CAP ON 2" STEEL PIPE
N.R.F. = NO RECORD FOUND
FS = EXCHANGE SURVEY NO. 359

#12
ES 359
CORNER NO. 45

USFS 1943
FD. 2" IP WITH 2 1/2" CAP IN STONE MOUND.
COR. FALLS ON SOUTH SLOPE, 100'± EAST OF A S/E CR. INTO LAKE.

FD. 24" D. FIR N51°W 24.8' H.B.
REC. 10" D. FIR N53°30'W 25.0' (FS)
A 13" D. FIR N6°30'E 11.2' S.B.T.

ES #359
#13
CORNER NO. 46

LS 3966 1990
SET STD. MON IN STONE MOUND.
COR. FALLS ON EAST EDGE OF N/S CR., 300'± WEST OF ROAD SWITCHBACK TO POWER HOUSE.
POSITION BY PROPORTION BETWEEN CORNERS 45 & 47

FD. 24" D. FIR S19°W 14.0' H.B.
REC. 10" D. FIR S28°E 14.4' (FS)
A 10" CEDAR N49°W 42.0' S.B.T.

#14
ES 359
USFS 1943
CORNER NO. 47


FD. 2" I.P. W/ 2 1/2" CAP IN STONE MOUND.
NO ACCESSORIES.

CORNER NO. 48

1/4 S19 | S20
REC. 30" FIR 1/4 SEC COR (GLO)
REC. 38" FIR 1/4 SEC COR (FS)
FD. TREE COR. 36" D. FIR V.S.
COR. FALLS ON NORTH SLOPE.
GLO RECORD 30" FIR

A 7" B. OAK N17°W 14.5' S.B.T.

RECORD OF SURVEY
FOR
USDA FOREST SERVICE
IN SECTIONS 4, 5, 8, AND 17 THRU 19
T20N R8E MDM
IN THE
UNINCORPORATED AREAS OF BUTTE & PLUMAS
COUNTIES, STATE OF CALIFORNIA

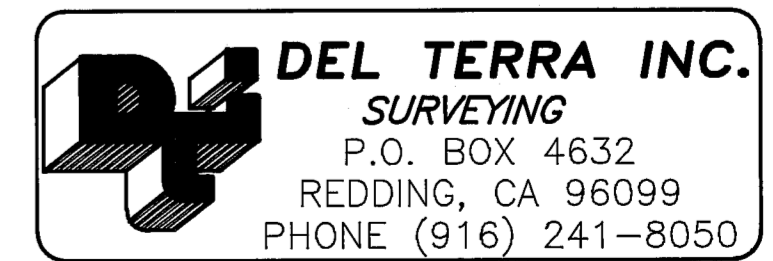

SCALE: 1" = 1000' DATE: MAY 1991
SHEET: 5 OF 5