

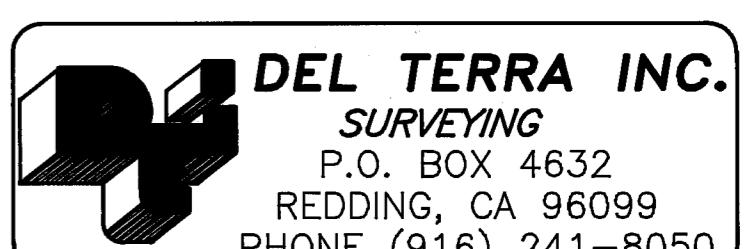
CORNER NOTES			
SC T21N R8E CORNER NO. 1	SC T21N R8E CORNER NO. 5	W 1/16 C—C CORNER NO. 14	SC T21N R8E CORNER NO. 19
S34 S35 FD. 2" X 2" HUB IN A MOUND OF STONE LS 3966 WITH BRASS TAG LS 1786. CORNER 1992 FALLS ON A GENTLE SOUTH SLOPE IN TIMBER, 280'+/- WEST OF A DIRT ROAD.	S35 S36 SET STD USFS D.I.M. IN A MOUND OF LS 3966 STONE. CORNER FALLS 50'+/- WEST OF 1992 A DIRT ROAD IN TIMBER AND BRUSH.	S2 FD. A 1 1/2" IRON PIPE. LS 3966 SET STD USFS D.I.M. IN A MOUND OF 1992 STONE. CORNER FALLS ON A STEEP SOUTHEAST SLOPE, 150' WEST OF A CREEK AND 300'+/- EAST OF A ROAD.	1/16 S11 SET STD USFS D.I.M. IN A MOUND OF LS 5623 STONE. CORNER FALLS ON A STEEP 1986 SOUTHEAST SLOPE. A SMALL SPRING BEARS S10'E, 55'
FD. A 40" SUGAR PINE BEARS N9'W, 20.2' -VS REC. AN 18" SUGAR PINE BEARS N8 3/4'W, 17.2' (GLO) FD. A 28" DEAD AND DOWN CEDAR BEARS S85'E, 48.1' REC. A 23" CEDAR BEARS S85 1/2'E, 50.2' (GLO) FD. A 29" YELLOW PINE BEARS S56'W, 13.1' -VS REC. A 7" PITCH PINE BEARS S35 3/4'W, 11.9' (GLO) A 6" FIR BEARS N66'E, 7.9' -SBT	FD. A 54" SUGAR PINE BEARS N16 1/2'E, 16.3' -HB REC. AN 10" SUGAR PINE BEARS N16 1/2'E, 15.8' (GLO) FD. A 45" CEDAR BEARS N76 3/4'E, 25.8' -VS REC. A 20" CEDAR BEARS N76 3/4'E, 24.2' (GLO) FD. A 24" FIR STUMP BEARS S20 1/2'W, 34.4' REC. A 24" FIR BEARS S20 1/2'W, 34.3' (GLO)	H.B. = HEALED BLAZE V.S. = VISIBLE SCRIBING S.B.T. = SCRIBED AS A BEARING TREE STD. USFS D.I.M. = 3 1/4" ALUM. CAP ON A 5/8" STEEL ROD	FD. A 12" WHITE FIR BEARS S85 1/2' W 25.4' -HB REC. ORIGIN UNKNOWN FD. A 25" DOUGLAS FIR BEARS S67'E, 34.0' -HB REC. ORIGIN UNKNOWN A 7" CEDAR BEARS N14'E, 27.0' -SBT
T21N R8E CORNER NO. 2	T21N R8E CORNER NO. 6	E 1/16 C—C CORNER NO. 15	T20N R8E CORNER NO. 21
S35 FD. STONE MOUND. (ORIGINAL C.C.) S3 S2 SET A STD USFS D.I.M. IN A MOUND OF T20N R8E STONE. CORNER FALLS ON A GENTLE CC SLOPE IN BRUSH AND SMALL LS 3966 TIMBER 600'+/- EAST OF A LOGGING 1992 ROAD.	S36 T20N R8E CORNER NO. 9 S2 S1 SET STD USFS D.I.M. IN A MOUND OF CC LS 3966 STONE. CORNER FALLS ON A WEST SLOPE 1992 100'+/- EAST OF AND 160'+/- NORTH OF ONION CREEK.	S2 SET STD USFS D.I.M. (NO STONE FOR LS 3966 MOUND). CORNER FALLS ON A STEEP 1992 SOUTH SLOPE.	S2 S1 FD. A STD BLM MONUMENT IN EARTH. S11 S12 CORNER FALLS ON A SEEP NORTHWEST 1973 SLOPE IN THICK BRUSH AND TIMBER.
NEW MONUMENT SET N00°49'34"W, 5.42' FROM ORIGINAL C.C.	ORIGINAL CLOSING CORNER FD. A MOUND OF STONE. CORNER FALLS ON A WEST SLOPE. NEW CLOSING CORNER BEARS N 00°39'21" W, 23.63'.	TRUE CORNER BEARS S89°50'27"W, 37.13' A 14" YELLOW PINE SCRIBED WITH AN "X" BEARS S29'E, 39.1' -SBT A 24" YELLOW PINE SCRIBED WITH AN "X" BEARS S28'W, 66.2' -SBT BT'S REFERENCED TO WITNESS CORNER	1/4 CORNER NO. 16 S2 S1 SET STD USFS D.I.M. (NO STONE FOR LS 3966 MOUND). CORNER FALLS 40'+/- EAST OF 1992 A NORTH-SOUTH RIDGE IN TIMBER.
FROM ORIGINAL CLOSING CORNER FD. A 38" CEDAR SNAG BEARS S52'W, 29.7' REC. A 28" CEDAR BEARS S52'W, 29.7' (GLO)	FD. A 40" FIR STUMP BEARS S70 1/4'W, 70.5' -HB REC. A 26" SPRUCE BEARS S70 1/4'W, 76.6' (GLO) FD. A 32" CEDAR BEARS S41'E, 70.0' -VS REC. A 22" CEDAR BEARS S41'E, 70.0' (GLO)	NE 1/16 CORNER NO. 10 LS 3966 SET STD USFS D.I.M. IN A MOUND OF 1992 STONE. CORNER FALLS ON A SEMI-FLAT SOUTH SLOPE, 100'+/- SOUTH OF AN OLD SKID ROAD AND 150'+/- EAST OF A DRAW. A 9" DOUGLAS FIR BEARS S4'E, 30.9' -SBT AN 8" DOUGLAS FIR BEARS S74'E, 11.4' -SBT	FD. STUMP HOLE WITH A SLAB OF SCRIBING @ REC. REC. A 21" YELLOW PINE BEARS N68'E, 10.6' (GLO) FD. A 32" FIR SNAG BEARS N16'W, 17.6' -VS REC. A 20" SPRUCE BEARS N16'W, 17.2' (GLO) AN 8" WHITE FIR BEARS N29'W, 17.3' -SBT A 9" CEDAR BEARS N69'E, 15.3' -SBT
FROM NEW CLOSING CORNER A 12" WHITE FIR BEARS S30'W, 41.6' -SBT A 15" SUGAR PINE BEARS S32'E, 60.1' -SBT		N 1/16 CORNER NO. 11 S2 S1 SET STD USFS D.I.M. (NO STONE FOR LS 3966 MOUND). CORNER FALLS ON A VERY 1992 STEEP NORTHWEST SLOPE 470'+/- EAST OF ONION CREEK IN HEAVY (FIR) TIMBER. AN 18" WHITE FIR BEARS N80'W, 9.9' -SBT A 20" WHITE FIR BEARS S9'E, 25.6' -SBT	1/4 CORNER NO. 17 S1 REC. A 40" YELLOW PINE (CORNER IS 1939 ON SOUTH FACE OF SAME). FD. A 43" SUGAR PINE 6.6' NORTH OF WITNESS CORNER. WITNESS CORNER IS A STD. 3" BRASS GLO MONUMENT. CORNER FALLS ON A STEEP NORTH SLOPE 250'+/- SOUTH OF SLATE CREEK.
SC CORNER NO. 3 T21N R8E 1/4 S35 FD. A 2 1/2" STEEL PIPE IN A ROCK LS 3966 MOUND. 1992 SET A STD USFS D.I.M. IN A MOUND OF STONE. CORNER FALLS ON AN EAST DESCENDING SLOPE 500'+/- FROM A RIDGE TOP IN TIMBER AND UNDERBRUSH.	SC T21N R8E CORNER NO. 7 1/4 S36 SET STD USFS D.I.M. IN A MOUND OF LS 3966 STONE. CORNER FALLS ON AN EAST 1992 SLOPE IN MEDIUM TIMBER (FIR) 150'+/- EAST OF A DRAW AND 200'+/- EAST OF A RIDGE. ROAD 21N99 IS 220'+/- SOUTH. FD. A ROTTED 66" SUGAR PINE WITH OLD FACE AND AX MARKS BEARS N25'E, 9.9' REC. A 55" SUGAR PINE BEARS N25'E, 9.9' (GLO) A 9" CEDAR BEARS N4'W, 24.5' -SBT A 13" CEDAR BEARS N69'E, 24.8' -SBT	NW 1/16 S1 CORNER NO. 12 LS 3966 SET STD USFS D.I.M. (NO STONE FOR 1992 MOUND). CORNER FALLS ON A SMALL FLAT RIDGE 160'+/- WEST OF A LOGGING ROAD IN HEAVY TIMBER. A 13" CEDAR BEARS S44'E, 18.6' -SBT A 10" CEDAR BEARS N81'W, 31.1' -SBT	NW 1/16 S1 CORNER NO. 12 LS 3966 SET STD USFS D.I.M. (NO STONE FOR 1992 MOUND). CORNER FALLS ON A SMALL FLAT RIDGE 160'+/- WEST OF A LOGGING ROAD IN HEAVY TIMBER. A 13" CEDAR BEARS S44'E, 18.6' -SBT A 10" CEDAR BEARS N81'W, 31.1' -SBT
T21N R8E CORNER NO. 4 1/4 S2 FD. A 1 3/4" PIPE CAP ON A 1 1/4" T20N R8E STEEL PIPE. LS 3966 SET A STD USFS D.I.M. CORNER FALLS 1992 ON AN EAST SLOPE 200'+/- WEST OF AN OLD LOGGING ROAD AND A SMALL CREEK. CORNER IS FLUSH WITH GROUND.	SC T21N R8E CORNER NO. 8 S36 S31 FD. A 3 1/2" GLO BRASS CAP ON A 2 R8E S31 1/2" STEEL PIPE IN A MOUND OF 1939 STONE. CORNER FALLS ON A SOUTHEAST SLOPE 70'+/- NORTHWEST OF AN OLD ROAD IN TIMBER. FD. STUMP HOLE S 17'E, 11' REC. A 72" SPRUCE BEARS S17'E 11.2' (GLO) FD. A 26" SNAG BEARS N19 1/2'E, 21.8' -VS REC. A 13" SUGAR PINE BEARS N19 1/2'E, 21.8' (GLO) FD. A 19" DOUGLAS FIR BEARS N45'E, 28.1' -HB REC. A 9" FIR BEARS N42'E, 27.7' (1939 GLO) FD. A 44" CEDAR BEARS N5'W 27.6' -HB REC. A 30" CEDAR BEARS N7 1/4'W, 27.7' (1939 GLO)	T20N R8E CORNER NO. 13 1/4 S3 S2 FD. 1 1/2" PIPE AND CAP. CORNER LS 3966 FALLS ON A SOUTHEAST SLOPE, 50'+/- 1992 WEST OF A NORTH-SOUTH CREEK AND 300'+/- NORTH OF A ROAD IN AN OLD LOGGING AREA. FD. DOWN AND ROTTEN PINE BEARS N51'W, 35'+/- REC. A 10" PITCH PINE BEARS N51'W, 35' (GLO) A 9" WHITE FIR BEARS S50'E, 5.1' -SBT AN 8" WHITE FIR BEARS S82'W, 15.1' -SBT	T20N R8E CORNER NO. 18 S3 S2 FD. A STD BLM MON IN A MOUND OF S10 S11 STONE WITH A 3/4" PIN ALONGSIDE 1973 TAGGED LS 2670. CORNER FALLS ON AN EAST SLOPE IN HEAVY BRUSH AND LIGHT TIMBER. FD. A 44" FIR SNAG BEARS N50'W, 26.7' -VS REC. A 45" WHITE FIR BEARS N50'W 27.7' (BLM) FD. A 30" WHITE FIR BEARS S45'E, 40.3' -VS REC. A 46" WHITE FIR BEARS S45'E, 37.6' (BLM) FD. A 16" WHITE FIR SNAG BEARS S9'W, 35.0' -VS REC. A 16" WHITE FIR BEARS S9'W, 35.0' (BLM) FD. AN 11" WHITE FIR BEARS N70'E, 6.9' -HB REC. A 6" WHITE FIR BEARS N70'E, 7.3' (BLM)
A 12" WHITE FIR BEARS S77'E, 41.7' -SBT A 14" WHITE FIR BEARS S33'W, 64.6' -SBT			

RECORD OF SURVEY

FOR

USDA FOREST SERVICE

"SLATE CREEK"

IN SECTIONS 1, 2, 11, AND 12
T20N R8E MDMIN THE
UNINCORPORATED AREAS OF YUBA & PLUMAS
COUNTIES, STATE OF CALIFORNIAP.O. BOX 4632
REDDING, CA 96099

PHONE (916) 241-8050

DATE: MAY 1992

SHEET: 2 OF 3