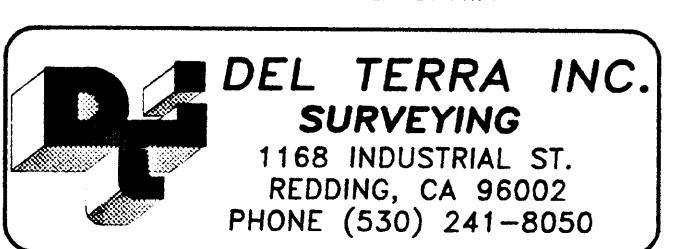


<p>T21N R8E CORNER No. 1</p> <p>S23 S24 CORNER PER ()1 NOT FOUND.</p> <p>S26 S25 SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM ROD FROM ORIGINAL BEARING TREE.</p> <p>LS 3966 2001 CORNER FALLS IN FILL BANK OF ROAD, 24± NORTH OF A CULVERT.</p> <p>FD. A 30" FIR STUMP, S70W, 42.2' -VS REC. A 10" SPRUCE, S70W, 42.2' -ORIG GLO TREE SCRIBED AN 8" DOUGLAS FIR, N1 3/4E, 25.4' "T21N R8E S24 BT" SCRIBED AN 18" DOUGLAS FIR, S57 1/2W, 36.2' "T21N R8E S24 BT"</p> <p>POSITION FOR CORNER FITS CALL TO CREEK VERY WELL</p>	<p>N 1/16 CORNER No. 6</p> <p>S25 S30 CORNER No. 6</p> <p>LS 3966 2001 SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM ROD IN A SMALL MOUND OF STONE. CORNER FALLS ON A TIMBERED FLAT AT NORTHWEST BOGE CAMP AREA WITH A POND.</p> <p>SCRIBED A 19" WHITE FIR, N37E, 24.8' "N 1/16 S30 BT" SCRIBED A 12" WHITE FIR, S27W, 27.5' "N 1/16 S25 BT" FD. A 1/2" IRON PIPE EAST 1.1' - NO ID. NOT ACCEPTED THIS SURVEY</p>	<p>CORNER NOTES</p> <p>HB = HEALED BLAZE VS = VISIBLE SCRIBING</p> <p>()1 RECORD PER 2 RS 81 ()2 RECORD PER GLO 1882 & 1884 ()3 RECORD PER 2 RS 83 ()4 RECORD PER 8 PM 58</p>		
<p>T21N R8E R9E CORNER No. 2</p> <p>S24 S19 CORNER No. 2</p> <p>S25 S30 FD. A 3 1/4" IRON PIPE IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM ROD IN PLACE OF PIPE. CORNER FALLS ON A MODERATE WEST SLOPE IN HEAVY TIMBER, 50± SOUTHWEST OF AN OLD ROAD.</p> <p>LS 3966 2001 FD. A 39" WHITE FIR, N88W, 27.1' -HB REC. AN 18" FIR, N88E, 27.1' ()2 FD. A 44" WHITE FIR SNAG, N12E, 27.7' -HB REC. A 30" SPRUCE, N14E, 27.7' ()2 SCRIBED A 10" DOUGLAS FIR, S77E, 19.9' "T21N R8E S30 BT" SCRIBED A 12" WHITE FIR, S43W, 38.7' "T21N R8E S25 BT" SCRIBED AN 8" WHITE FIR, N44E, 48.1' "T21N R8E S19 BT"</p>	<p>NW 1/16 S30 CORNER No. 7</p> <p>LS 3966 2001 SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM ROD ON A MOUND OF STONE. CORNER FALLS ON A TIMBERED FLAT, 180± EAST OF LAPORTE ROAD.</p> <p>SCRIBED A 12" INCENSE CEDAR, N76W, 11.9' NW 1/16 S30 BT" SCRIBED AN 11" DOUGLAS FIR, N53E, 9.6' NW 1/16 S30 BT" FD. A 1/2" IRON PIPE, N50E, 1.6' - LS 2900 NOT ACCEPTED THIS SURVEY</p>	<p>T21N R8E CORNER No. 13</p> <p>S26 S25 FD. A 1/2" IRON PIPE, NO CAP, IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM ROD. FRESHENED MOUND AND REMOVED PIPE. CORNER FALLS 40± EAST OF A ROAD ON A GENTLE EAST SLOPE.</p> <p>S35 S36 LS 3966 2001</p> <p>FD. A 19" INCENSE CEDAR, N17E, 10.3' -HB NO REC. FD. A 50" WHITE FIR, N30W, 25.7' -VS IN OPEN FACE REC. A 30" FIR, N30W, 25.7' ()2 SCRIBED A 14" INCENSE CEDAR, N37W, 17.7' "T21N R8E S26 BT" SCRIBED A 12" WHITE FIR, N53E, 26.8' "T21N R8E S25 BT" SCRIBED A 15" DOUGLAS FIR, S32E, 16.5' "T21N R8E S36 BT" SCRIBED A 6" CEDAR, S84W, 18.3' "T21N R8E S35 BT"</p>		
<p>T21N R8E CORNER No. 3</p> <p>1/4 S19 CORNER No. 3</p> <p>S25 S30 SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM ROD FROM BEARING. CORNER FALLS IN FILL BANK OF ROAD.</p> <p>LS 3966 2001 FD. A 25" INCENSE CEDAR, S79E, 23.8' -HB REC. A 16" INCENSE CEDAR, S80E, 23.8' ()2</p>	<p>T21N R8E 1/4 CORNER No. 8</p> <p>S26 S25 LS 3966 2001 SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM ROD FROM ORIGINAL BEARING TREE. CORNER FALLS ON A GENTLE SOUTHEAST SLOPE IN HEAVY TIMBER, 150± EAST OF LAPORTE ROAD.</p> <p>FD. A 41" SUGAR PINE, EAST, 12.5' - VS IN A SAWED OUT BLAZE REC. AN 8" SUGAR PINE, EAST, 12.5' ()2 SCRIBED A 10" DOUGLAS FIR, S24W, 14.5' "1/4 S26 BT"</p>	<p>LS 2670 T21N R8E CORNER No. 14</p> <p>S25 S30 S36 S31 1959 FD. A 1/2" METAL CONDUIT WITH A 1 1/2" BRASS CAP. CORNER FALLS ON THE WEST SIDE OF A NORTH-SOUTH SPUR IN HEAVY TIMBER.</p> <p>FD. A 59" PINE SNAG, N56E, 40.7' REC. A 60" PITCH PINE, N57 3/4E, 38.9' ()2 FD. A 56" SUGAR PINE, S75E, 62.7' -HB REC. A 27" SUGAR PINE, S73 1/2E, 62.7' ()2</p>		
<p>LS 2670 T21N R9E CORNER No. 4</p> <p>S19 S20 FD. A 5/8" IRON PIPE WITH A 1 1/2" BRASS CAP IN A MOUND OF STONE. CORNER FALLS ON A MODERATE SOUTHEAST SLOPE IN HEAVY TIMBER.</p> <p>S30 S29 1959 FD. A 9" WHITE FIR, S49W, 19.1' -HB REC. A 7" FIR, S49W, 19.1' ** FD. A 10" WHITE FIR, S3E, 32.3' -HB REC. A 10" FIR, S3E, 32.3' ** FD. A 56" PINE SNAG, S10E, 21.1' -VS REC. A 57" FIR SNAG, S10E, 21.1' ** FD. A 16" WHITE FIR, N20E, 15.8' -HB REC. 16" FIR, N20E, 15.8' ** FD. A 22" WHITE FIR, N44W, 16.5' -HB REC. A 18" FIR, N44W, 16.5' **</p> <p>** = PER USFS COR. REC. FILE NO R-5</p>	<p>T21N R8E 1/4 CORNER No. 9</p> <p>S25 S30 LS 3966 2001 SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM ROD IN PLACE OF PIPE. CORNER FALLS ON A FLAT, 50± NORTHEAST OF A ROAD.</p> <p>SCRIBED A 19" INCENSE CEDAR, S47E, 60.9' "1/4 S30 BT" FD. A 38" WHITE FIR, N4W, 41.2' -HB REC. A 34" FIR, N10W, 41.5' ()4 FD. A WHITE FIR STUMP, S45E, 35.9' -VS REC. A 44" FIR, S44E, 35.5' ()4</p>	<p>T21N R9E 1/4 S30 CORNER No. 15</p> <p>S31 LS 3966 2001 FD. A MOUND OF STONE WITH A SCRIBED POST. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM ROD IN MOUND. CORNER FALLS ON A STEEP SOUTH SLOPE IN TIMBER AND HEAVY UNDERBRUSH.</p> <p>FD. A 20" DOUGLAS FIR, N37E, 26.0' -HB REC. A 10" DOUGLAS FIR, S7E, 26.0' ()3 SCRIBED A 19" WHITE FIR, S15W, 19.3' "1/4 S31 BT"</p>	<p>LS 2670 T21N R9E CORNER No. 16</p> <p>S30 S29 S31 S32 1959 FD. A 5/8" IRON PIN WITH A 1 1/2" BRASS CAP IN A MOUND OF STONE. CORNER FALLS ON A STEEP SOUTH SLOPE, 40± WEST OF A RAVINE IN THICK TIMBER.</p> <p>FD. A 17" WHITE FIR, S41 1/2E, 29.0' -HB REC. A 12" DOUGLAS FIR, S41 1/2E, 29.2' ()3 FD. A 42" FIR STUMP, N43E, 54.8' -VS - SCRIBED FACE BEARS S15E REC. A 14" FIR, N45E, 54.8' ()2 FD. A 25" WHITE FIR, S83W, 6.6' -HB REC. AN 18" WHITE FIR, S70W, 8.0' ()3 FD. A 25" WHITE FIR, N20W, 29.7' -HB REC. A 16" DOUGLAS FIR, N20E, 29.9' ()3</p>	
<p>N 1/16 CORNER No. 5</p> <p>S26 S25 LS 3966 2001 NOTHING FD. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM ROD. CORNER FALLS ON A MODERATE, BRUSHY NORTH SLOPE.</p> <p>SCRIBED A 9" WHITE FIR, S30 1/2E, 7.8' "N 1/16 S25 BT" SCRIBED A 7" WHITE FIR, S5 3/4W, 23.6' "N 1/16 S26 BT"</p>	<p>LS 2670 1/4 CORNER No. 11</p> <p>S30 S29 1959 FD. A 5/8" IRON ROD WITH A 1 1/2" BRASS CAP IN A MOUND OF STONE. CORNER FALLS ON A MODERATELY SLOPED SOUTH SPUR.</p> <p>FD. AN 18" DOUGLAS FIR, N64W, 19.8' -HB REC. A 12" WHITE FIR, N69W, 19.7' ()3 FD. A DEAD AND DOWN FIR, N35E, 25.7' REC. A 16" WHITE FIR, N29E, 25.6' ()3</p>		<p>RECORD OF SURVEY</p> <p>FOR</p> <p>USDA FOREST SERVICE</p> <p>"LOWER SLATE 1"</p> <p>IN SECTION 25, T 21 N, R 8 E, AND SECTION 30, T 21 N, R 9 E, MDM IN THE UNINCORPORATED AREA OF PLUMAS COUNTY, STATE OF CALIFORNIA</p>	
 <p>DEL TERRA INC. SURVEYING 1168 INDUSTRIAL ST. REDDING, CA 96002 PHONE (530) 241-8050</p>	<p>DATE: AUGUST, 2001 SHEET 2 OF 2</p>	<p>I2 RS 38</p>		