

CORNER NOTES

HB = HEALED BLAZE
VS = VISIBLE SCRIBING
()1 = GLO 1874

RM
T26N R14E CORNER No. 3
S22 10.0'
TO COR
LS 3966 2001
FOUND A 45" PINE SNAG WITH SCRIBING VISIBLE ON WEST FACE. REC. A 46" PITCH PINE ()1. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD S 45° E, 10.00' FROM THE TREE CORNER FOR REF. MON. CORNER FALLS ON A TIMBERED FLAT, 200± SOUTH OF A MEADOW.
SCRIBED A 17" PONDEROSA, S22°E, 33.0'
"T26N R14E S22 BT"
SCRIBED A 9" PONDEROSA, S53°W, 29.9'
"T26N R14E S21 BT"
SCRIBED AN 8" PONDEROSA, N65°W, 46.0'
"T26N R14E S16 BT"

CORNER No. 8
SE 1/16 · S22
LS 3966 2001
SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD IN A MOUND OF STONE. CORNER FALLS AMONG BOULDERS BETWEEN A BRUSHY CREEK AND LIGHT PINE FOREST TO THE SOUTHEAST.
SCRIBED A 16" YELLOW PINE, S6°W, 45.3'
"SE 1/16 BT"
SCRIBED A 17" YELLOW PINE, S51°E, 36.0'
"SE 1/16 BT"

CORNER No. 22
T26N R14E
S20|S21
S29|S28
LS 3966 2001
FD. A 13 X 10 X 8 INCH STONE (17 X 13 X 8) WITH 4 NOTCHES EAST AND 2 NOTCHES SOUTH IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS ON A MODERATE EAST SLOPE IN JUNIPER PINE AND MAHOGANY.
FD. A 27" BIFURCATED JUNIPER, N37°E, 5.9' -VS
REC. A 28" JUNIPER NORTHEAST, 5.9' ()1
FD. A 16" JUNIPER, N74°W, 85.6' -VS
REC. A 14" JUNIPER, N76°W, 84.5' ()1
REC. 10" MAHOGANY PER ()1 NOT FD
SCRIBED AN 11" SUGAR PINE, S20°W, 19.6'
"T26N R14E S29 BT"

T26N R14E CORNER No. 4
1/4 S15
S22
LS 3966 2001
GLO RECORD STONE NOT FOUND. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD IN A MOUND OF STONE FROM GLO BEARING TREE. CORNER FALLS ON A MODERATE NORTHEAST SLOPE IN PINE TIMBER, 40± SOUTHWEST OF A GRASSY SWALE.
FD. A 42" YELLOW PINE STUMP, S82°W, 94.4'
REC. A 30" YELLOW PINE, S82°W, 94.4' ()1
SCRIBED AN 11" PONDEROSA, N30°W, 4.4'
"1/4 S15 BT"
SCRIBED A 12" PONDEROSA, S70°W, 15.7'
"1/4 S22 BT"

CORNER No. 9
S 1/16
S22|S23
LS 3966 2001
SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD IN A MOUND OF STONE. CORNER FALLS ON A GRADUAL WESTERLY SLOPE IN SMALL PINE AND FIR.
SCRIBED A 9" YELLOW PINE, N77 1/2°E, 15.7'
"S 1/16 S23 BT"
SCRIBED A 7" YELLOW PINE, N43°W, 28.3'
"S 1/16 S23 BT"

CORNER No. 14
W 1/16 S23
S26
LS 3966 2001
SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD IN A MOUND OF STONE. CORNER FALLS AT THE EDGE OF A GRASSY MEADOW IN SAGEBRUSH.
NO TREES AVAILABLE.

T26N R14E CORNER No. 5
S15|S14
S22|S23
LS 3966 2001
FD. A 26 X 10 X 6 INCH (36 X 12 X 10) STONE IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS 75± NORTH OF THE TOP OF AN EAST-WEST RIDGE, 15± EAST OF A LARGE PILE OF BOULDERS. STEEP DESCENT TO NORTH.
FD. A FIR STUMP, N41°E, 38.9'
REC. AN 18" FIR, N41°E, 38.9' ()1
FD. A FIR SNAG, S58 1/2°E, 56.8'
REC. A 7" FIR, S58 1/2°E, 56.8' ()1
REC. 24" PINE PER ()1 NOT FD.
SCRIBED A 9" PONDEROSA, S37°E, 25.2'
"T26N R14E S23 BT"
SCRIBED A 10" PONDEROSA, N87°E, 31.0'
"T26N R14E S14 BT"
SCRIBED AN 11" PONDEROSA, N83°W, 6.0'
"T26N R14E S15 BT"
SCRIBED AN 8" PONDEROSA, S48°W, 31.0'
"T26N R14E S22 BT"

T26N R14E CORNER No. 10
S21|S22
S28|S27
LS 3966 2001
SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD IN A MOUND OF STONE FROM ORIG. BT'S. CORNER FALLS WEST OF THE TOP OF A RIDGE IN PINES.
FD. DOWN PINE, S53°E, 54.8' -VS
REC. A 28" PINE, S53°E, 54.8' ()1
FD. DOWN AND ROTTEN PINE, S65°W, 93.1' -VS
REC. A 14" PINE, S65°W, 93.1' ()1
SCRIBED A 13" PONDEROSA, N23°W, 15.7'
"T26N R14E S21 BT"
SCRIBED AN 8" PONDEROSA, N40°E, 21.8'
"T26N R14E S22 BT"
SCRIBED A 16" PONDEROSA, S64°E, 24.8'
"T26N R14E S27 BT"
SCRIBED A 14" PONDEROSA, S21°W, 30.5'
"T26N R14E S28 BT"

T26N R14E CORNER No. 15
1/4 S23
S26
1960
FD. A 3 1/2" DEPT. OF WATER RESOURCES BRASS CAP IN A MOUND OF STONE. CORNER FALLS SOUTHWEST OF A SMALL, ROCKY KNOLL, 4' EAST OF A NORTH-SOUTH FENCE.
FD. A DEAD AND DOWN PINE, S47°E, 47.5' -VS
REC. A 23" PINE, S47°E, 47.5' ()1
NO NEW BEARING TREES TAKEN

T26N R14E CORNER No. 6
1/4 S21|S22
LS 3966 2001
FD. A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS NEAR THE TOP OF A SMALL SPUR RUNNING GENERALLY NORTHEAST IN SMALL PINES AND MINIMAL BRUSH.
SCRIBED A 12" PONDEROSA, S25°E, 15.9'
"1/4 S22 BT"
SCRIBED A 15" PONDEROSA, S59°W, 5.1'
"1/4 S21 BT"

T26N R14E CORNER No. 11
1/4 S22
S27
LS 3966 2001
FD. A 24 X 10 X 10 INCH ()1 STONE IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS ON A GRADUAL EAST SLOPE IN LARGE PINES.
FD. A 30" PONDEROSA, S4°E, 10.6' -HB
REC. A 20" PINE, S4°E, 10.6'
SCRIBED A 28" PONDEROSA, N36°E, 18.1'
"1/4 S22 BT"

T26N R14E CORNER No. 16
1/4 S27|S26
LS 3966 2001
FD. A 20 X 16 X 8 INCH STONE (20 X 18 X 18) IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS ON A MODERATE WEST SLOPE IN PATCHY MANZANITA AND JUNIPER BRUSH.
FD. ROTTEN PINE REMAINS, N81°E, 29.7' -VS
REC. A 10" PINE, N81°E, 29.7' ()1
NO SUITABLE TREES AVAILABLE

T26N R14E CORNER No. 7
1/4 S22|S23
LS 3966 2001
FD. A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS ON A MODERATE SOUTHERLY SLOPE IN LARGE PINES AND FIR.
FD. A DEAD AND DOWN PINE WITH A BURNT FACE, N76°W, 71.3'
REC. A 28" PINE N76°W, 71.3' ()1
REC. 30" PINE PER ()1 NOT FD.
REC. 40" PINE PER ()1 NOT FD.
SCRIBED AN 8" PONDEROSA, S11°E, 9.0'
"1/4 S23 BT"
SCRIBED A 17" PONDEROSA, N77°W, 11.4'
"1/4 S22 BT"

T26N R14E CORNER No. 12
E 1/16 S22
S27
LS 3966 2001
SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD IN A MOUND OF STONE. CORNER FALLS AT THE WEST EDGE OF A LARGE MEADOW.
SCRIBED A 18" YELLOW PINE, N33°W, 79.2'
"E 1/16 S22 BT"
SCRIBED A 20" BIFURCATED YELLOW PINE, S76°W, 46.7'
"E 1/16 S27 BT"

T26N R14E CORNER No. 17
S27|S26
S34|S35
LS 3966 2001
FD. A 26 X 15 X 8 INCH STONE (30 X 22 X 10) IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS ON THE EAST SIDE NEAR THE TOP OF A RIDGE IN A ROCKY, BRUSHY AREA.
FD. A MAHOGANY SNAG, N37°W, 55.4'
REC. A 10" MAHOGANY, N37 1/4°W, 55.4' ()1
FD. A DOWN PINE SNAG, S59 3/4°W, 101.6'
REC. A 28" PINE, S59 3/4°W, 101.6' ()1
REC. 33" PINE PER ()1 NOT FD.
NO SUITABLE TREES AVAILABLE

T26N R14E CORNER No. 13
S22|S23
S27|S26
LS 3966 2001
SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD IN A MOUND OF STONE AT DOUBLE PROPORTION POSITION USING CORNERS 7, 11, 15 AND 16. CORNER FALLS IN A GRAVEL BAR OF A MEANDERING CREEK IN AN OPEN MEADOW, 350± NORTH OF AN OLD LOG CABIN
NO TREES AVAILABLE.


T26N R14E CORNER No. 20
1/4 S28|S27
LS 3966 2001
FD. A 17 X 16 X 12 INCH STONE (28 X 27 X 16) WITH CHISELED "1/4" VISIBLE IN A MOUND OF STONE. SET A 3 1/4" USFS ALUM. CAP ON A 5/8" ALUM. ROD AND FRESHENED MOUND. CORNER FALLS ON A SMALL ROCKY OPENING ON A GENTLE EAST SLOPE.
FD. A 13" JUNIPER, S45°E, 37.0' -VS
REC. AN 8" JUNIPER, S63 1/2°E, 37.0' ()1
SCRIBED A 9" JUNIPER, S75°W, 39.5'
"1/4 S28 BT"
SCRIBED A 6" JUNIPER, N10°E, 38.9'
"1/4 S27 BT"

RECORD OF SURVEY

FOR
USDA FOREST SERVICE
PLUMAS NATIONAL FOREST

"LAST CHANCE 2"

IN SECTIONS 21, 22, 23, 26, 27 AND 28 IN
T. 26 N., R. 14 E., M.D.M., IN THE
UNINCORPORATED AREA OF PLUMAS COUNTY,
STATE OF CALIFORNIA

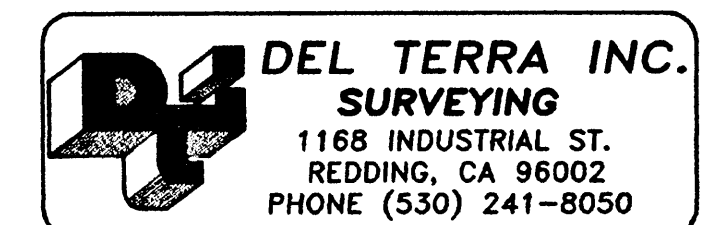

DATE: OCTOBER, 2001

SHEET 2 OF 2