

<p>T27N R9E CORNER No. 1 S21 S22 S28 S27 C4/ 1963</p> <p>FD. A 2 1/2" ALUM. CAP ON A 3/4" PIPE PER (9). CORNER FALLS 300± SOUTHEAST OF A ROAD.</p> <p>FD. A 15" YELLOW PINE, N39°W, 12.9' REC. A 13" PONDEROSA PINE, N39°W, 12.9' (9) FD. A 19" YELLOW PINE, S52 1/2W, 30.6' REC. A 17" PONDEROSA PINE, S52 1/2W, 30.7' (9) FD. A 26" CEDAR, N47E, 29.7' REC. A 24" CEDAR, N47E, 29.7' (GLO)</p>	<p>LS O 2702 CORNER No. 10 [SW COR. SEC. 27] FD. A 1/2" PIPE TAGGED LS 2702. CORNER FALLS 200± SOUTH OF GREENVILLE - WOLF CREEK ROAD.</p> <p>FD. A 14" DOUGLAS FIR, N87°W, 11.9' -HB FD. A 9" DOUGLAS FIR, N24E, 11.6' -HB FD. A 13" DOUGLAS FIR, S39E, 40.6' -HB REC ACCESSORIES PER (2) IN ERROR CORNERS 3 AND 5 PER (2) HAVE SAME BT'S</p>	<p>CORNER NOTES</p> <p>HB = HEALED BLAZE VS = VISIBLE SCRIBING</p> <p>()1 RECORD PER 11 RS 29 ()2 RECORD PER 10 PM 82 ()3 RECORD PER 7 RS 145 ()4 RECORD PER 5 RS 94 ()5 RECORD PER 5 RS 3 ()6 RECORD PER 5 PM 43 ()7 RECORD PER 4 RS 84 ()8 RECORD PER 2 RS 35 ()9 RECORD PER USFS CORNER NOTES ()10 RECORD PER 4 RS 129</p>	<p>LS 4753 CORNER No. 25 [SW 1/16 SEC. 35] 2003 FD. A 1 1/4" IRON PIPE WITH A SCREW ON CAP WHICH BEARS N70°25'W, 5.09' FROM TRUE POSITION - NOT ACCEPTED THIS SURVEY. SET A 1/2" REBAR WITH A 2" ALUM. CAP. CORNER FALLS ON A STEEP NORTH SLOPE, 40± EAST OF A RAVINE. NO ACCESSORIES TAKEN</p>
<p>T27N R9E CORNER No. 2 S21 S22 S28 S27 C4/ 1962</p> <p>FD. A 2 1/2" ALUM CAP ON A 3/4" PIPE PER (9). CORNER FALLS 200± EAST OF A ROAD.</p> <p>FD. A 29" SUGAR PINE, N83°W, 48.8' REC. A 20" SUGAR PINE, S83E, 48.8' (9)</p>	<p>LS O 2702 CORNER No. 11 [S 1/4 SEC. 27] FD. A 1" BAR TAGGED LS 2702 (3/4" PIPE PER (1)). CORNER FALLS UNDER A WOODPILE IN A YARD.</p> <p>FD. A 14" SUGAR PINE, N71°E, 19.9' -HB REC. A 12" PINE, N70° 36'E, 19.8' (9) FD. A 17" SUGAR PINE, N85°W, 14.5' -HB REC. A 15" PINE, N85° 26'W, 14.5' (9)</p>	<p>CORNER No. 19 [C 1/4 SEC. 34]</p>	<p>LS 4753 NO RECORD CORNERS OR ACCESSORIES FOUND FOR THIS POSITION. 2003 SET A 1/2" REBAR WITH A 2" ALUM. CAP. CORNER FALLS 6' EAST OF WOLF CREEK CHANNEL.</p> <p>NO TREES AVAILABLE - AREA CLEARCUT</p>
<p>T27N R9E CORNER No. 4 S21 S27 C4/ 1961</p> <p>FD. A 2 1/2" ALUM CAP ON A 3/4" PIPE PER (9). CORNER FALLS 150± WEST OF A POWER LINE ROAD BY A CREEK.</p> <p>FD. A 34" YELLOW PINE, S10E, 5.8' REC. A 30" PINE, S10E, 6.0' (1) FD. A 24" DOUGLAS FIR, EAST, 46.2' REC. A 17" DOUGLAS FIR, WEST, 46.2' (9) FD. A 27" DOUGLAS FIR, N45°W, 14.5' REC. A 17" DOUGLAS FIR, N45°W, 14.5' (9)</p>	<p>LS 4753 CORNER No. 12 [SE COR. SEC. 27] 2003 FD. A 1 1/2" PIPE (2" PIPE PER (10)) WITH A BLANK 2" STEEL CAP. STAMPED CAP WITH DATE AND LS 4753. CORNER FALLS 25± NORTH OF A DIRT ROAD.</p> <p>ACCESSORIES PER (10) NOT FOUND</p>	<p>CORNER No. 20 [E 1/4 SEC. 34]</p>	<p>LS 4753 FD. A 1 1/2" PIPE WITH A 2" STEEL CAP (CAP (ILLEGIBLE)). STAMPED CAP WITH DATE AND LS 4753. CORNER FALLS 200± EAST OF A ROAD ON AN EAST SLOPE</p> <p>FD. A 14" YELLOW PINE, S83°E, 19.0' REC. A 12" PINE, S85°15'E, 18.15' (9)</p>
<p>CORNER No. 6 [CE 1/16 SEC. 27]</p> <p>FD. A 1/2" REBAR WITH CAP STAMPED RCE 13309 PER (1), N2117°W, 1.60' FROM TRUE POSITION. NOT ACCEPTED THIS SURVEY. CORNER FALLS ON A STEEP NORTH SLOPE IN SCATTERED TIMBER.</p> <p>FD. K-TAGGED 13" PINE, N15E, 15.0' REC. A 12" PINE, N15E, 15' (1) FD. A 24" PINE, SOUTH, 8.5' REC. A 24" PINE, S90E, 8.5' (1)</p> <p>NOTE: BT'S MEASURED FROM REBAR AND CAP</p>	<p>LS 4753 CORNER No. 14 2003 SET A 3 1/2" USFS ALUM CAP ON A 5/8" ALUM ROD. CORNER FALLS IN A FLAT, GRASSY AREA BETWEEN WOLF CREEK AND TROUGH CREEK.</p> <p>SET A 3 1/2" USFS ALUM CAP ON A 5/8" ALUM. ROD FOR REFERENCE MONUMENT, S75E, 22.5' SET A 3 1/2" USFS ALUM CAP ON A 5/8" ALUM. ROD FOR REFERENCE MONUMENT, S11E, 25.2'</p>	<p>CORNER No. 21 [CW 1/16 SEC. 35]</p> <p>ACCESSORIES PER (10) NOT FOUND - NONE TAKEN</p>	<p>LS 4753 CORNER No. 30 [SE COR SEC. 35] RCE 22836 FD. A 1" PIPE TAGGED RCE 22836 (NO RECORD) (3/4" STEEL BAR RCE 13528(3)) (1" IRON PIN RCE 26870 (4)). CORNER FALLS 200± FROM PICK STREET NORTH.</p> <p>FD. AN 28" OAK, N47E, 28.5' REC. A 24" OAK, N47E, 28.7' (3)</p>
<p>T27N R9E CORNER No. 7 S21 S26 C4/ 1963</p> <p>FD. A 2 1/2" ALUM. CAP ON A 3/4" PIPE PER (9). CORNER FALLS 25± NORTHEAST OF A ROAD ON A HILLTOP.</p> <p>FD. A 24" DOUGLAS FIR, S48E, 28.2' REC. AN 18" FIR, S50E, 28.0' (1) FD. A 40" INCENSE CEDAR, N55E, 47.5' REC. A 37" INCENSE CEDAR, N55E, 47.5' (9)</p>	<p>LS 4753 CORNER No. 15 2003 SET A 3 1/2" USFS ALUM CAP ON A 5/8" ALUM. ROD. CORNER FALLS 21± SOUTH OF A PAVED ROAD OFF OF HIGHWAY 89 LEADING TO THE HORSESHOE PIT.</p> <p>SCRIBED A 27" PONDEROSA PINE, N18E, 13.8' SET A 3 1/2" USFS ALUM CAP ON A 5/8" ALUM. ROD FOR REFERENCE MONUMENT, S33E, 15.0'</p>	<p>CORNER No. 22 [W 1/4 SEC. 35]</p> <p>FD. A 2" IRON PIPE TAGGED LS 4036 PER (5) IN A MOUND OF STONE AT WEST FENCE CORNER. CORNER FALLS IN A TIMBERED FLAT, 100± SOUTH OF A SHALLOW RAVINE</p> <p>FD. A 16" PINE, N2E, 28.5' -HB REC. A 15" PINE, N2E, 28.5' (5) FD. A TAGGED 16" PINE, N52E, 47.4' REC. A 10" PINE, N52E, 47.4' (5)</p>	
<p>SE 1/16 S27 CORNER No. 8 LS 4753 2003</p> <p>SET A 3 1/2" USFS ALUM CAP ON A 5/8" ALUM. ROD. CORNER FALLS ON A MODERATE NORTHWEST SLOPE IN YELLOW PINE AND CEDAR.</p> <p>SCRIBED AN 8" PONDEROSA PINE, N72E, 65.5' SCRIBED A 14" YELLOW PINE, S21E, 6.5'</p>	<p>LS 4753 CORNER No. 17 2003 FD. A 1 1/2" PIPE WITH A 2" STEEL CAP. CORNER FALLS 250± NORTHEAST OF RAILROAD TRACKS.</p> <p>FD. A 18" YELLOW PINE, N40E, 22.4' REC. A 16" PINE, N38° 26'E, 22.7' (2) FD. A 21" YELLOW PINE, N55W, 12.0' REC. A 20" PINE, N58°07'W, 12.2' (2)</p>	<p>CORNER No. 23 [CS 1/16 SEC. 34]</p> <p>FD. A 1" PIPE TAGGED LS 3621 (3/4" PIPE PER (7)). CORNER FALLS IN A FLAT AREA 35± SOUTH OF A SMALL DRAINAGE.</p> <p>FD. A 29" PONDEROSA PINE, S25 1/2E, 14.2' -HB REC. A 22" YELLOW PINE, N32W, 14.4' (7) FD. A 30" PONDEROSA PINE, S73E, 11.1' -HB REC. A 18" YELLOW PINE, N88W, 11.0' (7)</p>	
<p>T27N R9E CORNER No. 9 S1/16 S27-S26 RLS 4481 1979</p> <p>FD. A USFS ALUM. CAP IN A MOUND OF STONE. CORNER FALLS ON TOP OF A NORTH-SOUTH SPUR, 40± EAST OF A ROAD.</p> <p>FD. A 23" INCENSE CEDAR, N55 1/2E, 10.3' -VS NO RECORD FOUND FD. A DEAD AND DOWN PINE, S51W, 21.9' -VS NO RECORD FOUND</p>	<p>LS O 3621 CORNER No. 18 [CW 1/16 SEC. 34] S34 S35 LS 4753 2003 FD. A 1 1/4" USFS ALUM. CAP ON A 5/8" ALUM ROD. CORNER FALLS ON TOP OF A NORTH SOUTH SPUR.</p> <p>SCRIBED AN 8" INCENSE CEDAR, S77W, 5.5' SCRIBED A 7" INCENSE CEDAR, N64E, 13.4'</p>	<p>CORNER No. 24</p>	<p>SEC COR 33 34 4 3 LS 2587 CORNER No. 29</p> <p>FD. A 1 1/2" PIPE WITH A 2" STEEL CAP PER (7). CORNER FALLS 30± SOUTHWEST OF A SKID TRAIL.</p> <p>FD. A 24" CEDAR, S29 1/2E, 12.5' -VS FD. A 24" INCENSE CEDAR, N55W, 14.5' -VS NO RECORD BT'S FOUND</p>


RECORD OF SURVEY

FOR

USDA FOREST SERVICE
PLUMAS NATIONAL FOREST

"MAIDU"

IN SECTIONS 27, 34 AND 35,
T. 27 N., R. 9 E., MDM, IN THE
UNINCORPORATED AREA OF
PLUMAS COUNTY,
STATE OF CALIFORNIA

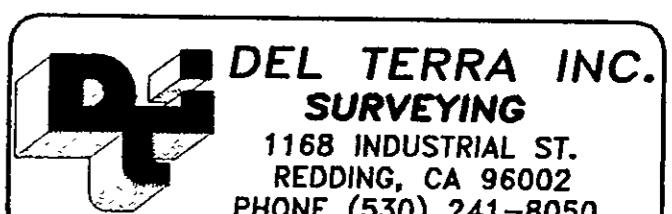

SCALE: 1" = 1000' DATE: JULY, 2003
SHEET 2 OF 2