

① SET STD USFS DRIVE-IN MONUMENT IN A MOUND OF STONE (SE 1/16 S26)
FWBS:
FD 1/2" REBAR LS2702, N88°27'46"W, 6.35'
FD 12" BLACK OAK (CLOSED FACE)
N81°18'W, 40.6'
FD 9" BLACK OAK (CLOSED FACE)
N06°19'W, 18.5'

② SET STD USFS DRIVE-IN MONUMENT IN A MOUND OF STONE (CS 1/16 S26)
FWBS:
FD 1 1/4" IP RCE 13528, N89°29'W, 12.6'
SET BY JIM BROCK USING (R2)
MKD 9" PINE, N74°14'W, 239.7'
FD 8" BLACK OAK (CLOSED FACE)
N89°09'W, 166.2'

③ SET STD USFS DRIVE-IN MONUMENT IN A MOUND OF STONE (SW 1/16 S26)
FWBS:
MKD 19" PINE, N15°53'W, 6.7'
MKD 19" PINE, S19°03'W, 11.3'


④ SET STD USFS DRIVE-IN MONUMENT IN A MOUND OF STONE (CW 1/16 S26)
FWBS:
MKD 13" PINE, N1°04'E, 10.7'
MKD 11" PINE, S59°05'W, 21.0'

⑤ SET STD USFS DRIVE-IN MONUMENT IN A MOUND OF STONE (CN 1/16 S26)
FWBS:
MKD 28" PINE, N06°08'E, 89.6'
MKD 6" PINE, N06°49'W, 81.5'

⑥ FD 2" OD IP RCE 18584
MOUND OF STONE (1/4 CORNER S26/S23)
FWBS:
MKD 7" PINE, N11°16'E, 5.6'
MKD 6" PINE, N66°57'E, 8.5'

⑦ FD 2" OD IP RCE 18584
MOUND OF STONE (CS 1/16 S23)
FWBS:
MKD 6" PINE, N40°36'E, 14.9'
MKD 6" PINE "X"BT, S20°17'E, 28.4'


⑧ FD 2" OD IP RCE 18584
MOUND OF STONE (SE 1/16 S23)
FWBS:
MKD 8" PINE, N32°05'E, 25.9'
MKD 8" PINE, S87°56'W, 33.6'

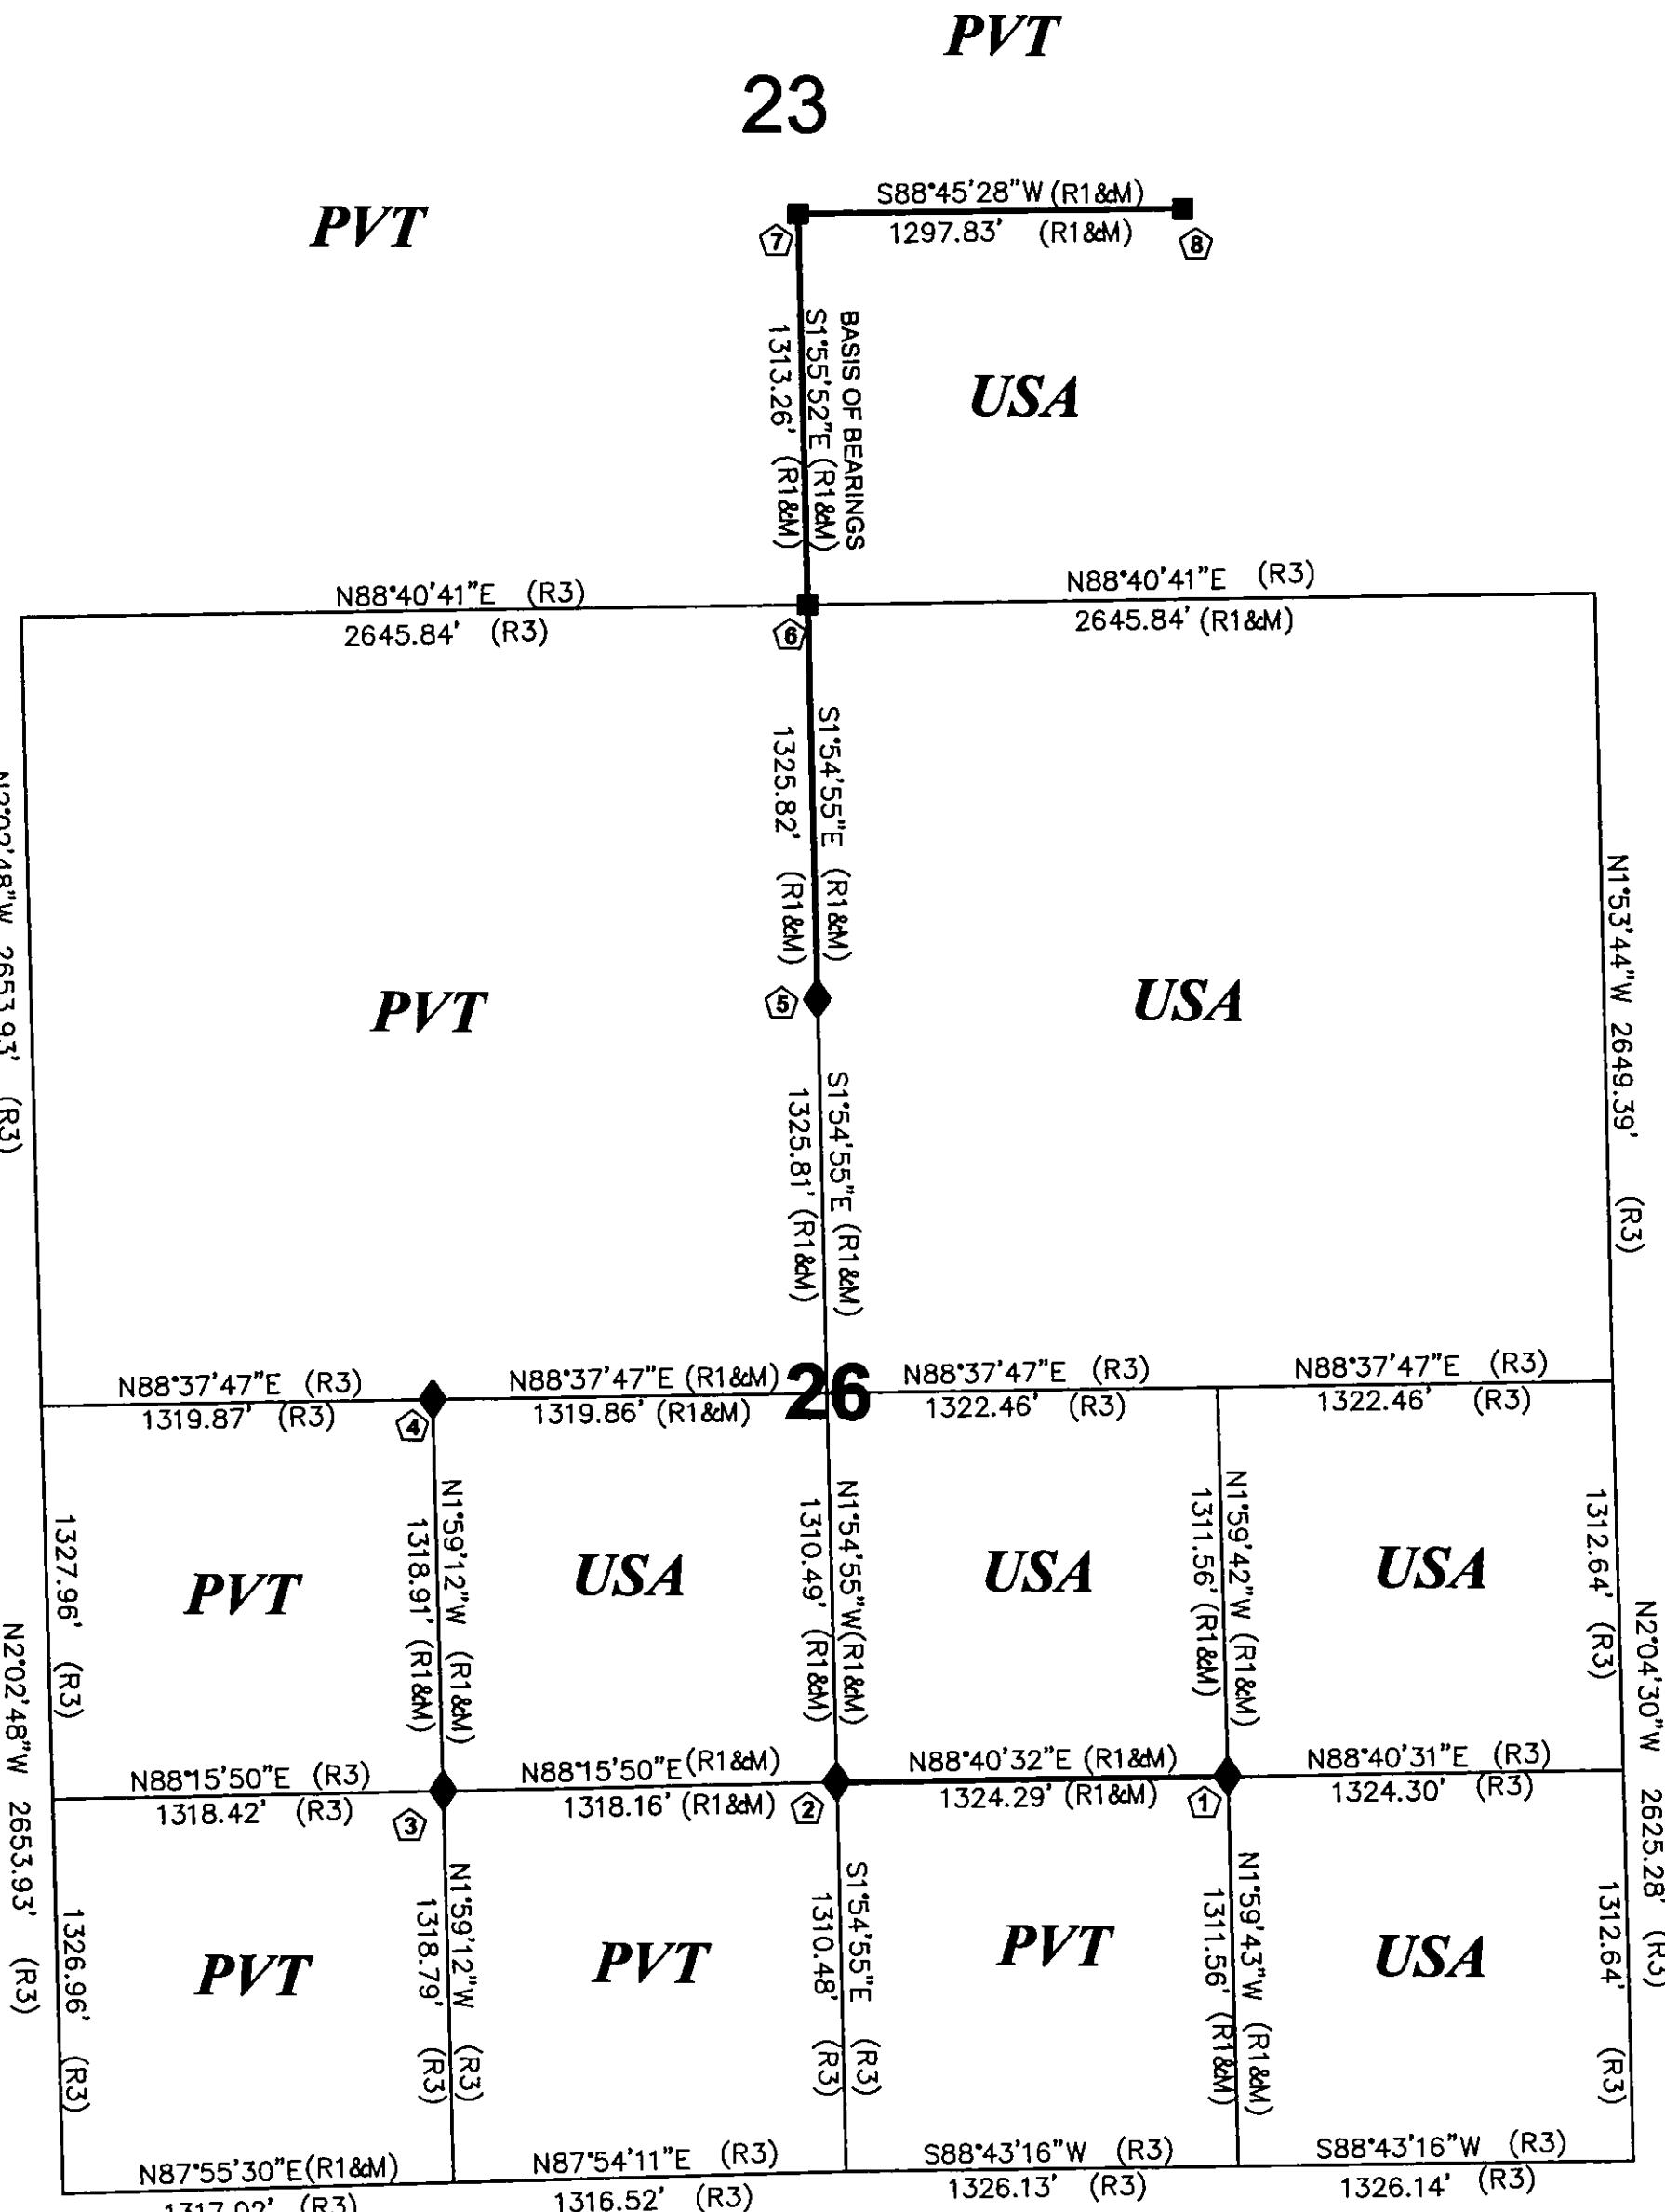

VICINITY MAP
NO SCALE

16	15	14	13
21	22	23	24
28	27	26	25
33	34	35	36

T26N T25N R10E R11E

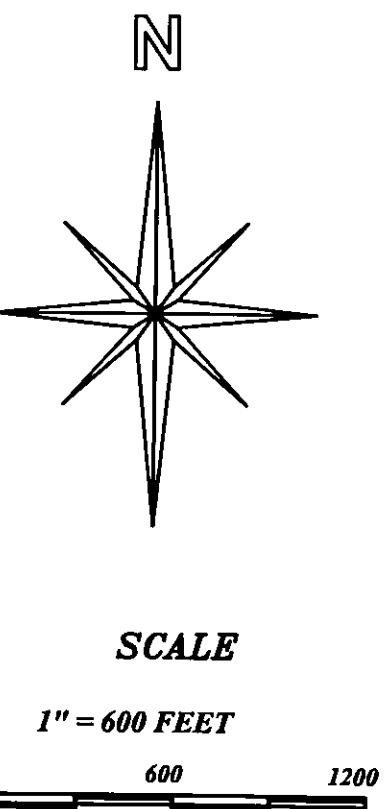

BASIS OF BEARING
MEASURED BEARINGS ARE BASED ON A RECORD OF SURVEY BY WILLIAM JOHNSON (RCE18584) RECORDED AT BOOK 6, PAGE 39.

GENERAL NOTES
A STANDARD UNITED STATES FOREST SERVICE (USFS) DRIVE-IN MONUMENT IS A 5/8" DIAMETER ALUMINUM ROD WITH A 3-1/4" ALUMINUM CAP EDGE-MARKED WITH THE USFS LOGO.

NOTE
CORNERS NUMBER ① AND ② WHERE RE-ESTABLISHED BASED ON THE (R1) SURVEY. THE REASON FOR THE DIFFERENCE IN CORNER LOCATIONS IS DUE TO THE DISAGREEMENT AS TO THE RESOLUTION OF THE NORTH 1/4 CORNER SECTION 26. I REJECTED LS2702 N1/4 CORNER POSITION (R2) I ACCEPTED RCE18584 N1/4 CORNER POSITION (R1) BECAUSE I BELIEVE WILLIAM JOHNSON'S CORNER HAS THE BEST SUPPORTING CORNER EVIDENCE.

SURVEY HISTORY

R1 6RS39	1981	RCE 18584
R2 3RS76	1966	RLS 2702
R3 CALC.FROM 6RS39	2002	RLS 5623

LEGEND

- FOUND CORNER AS NOTED
- ◆ SET STANDARD U.S. FOREST SERVICE DRIVE-IN MONUMENT (BEARING TREES AS NOTED)
- PROPERTY BOUNDARY MARKED AND POSTED
- ① CORNER NOTE



RECORD OF SURVEY
SECTIONS 23 & 26 T26N R10E, MDM

PLUMAS COUNTY, CALIFORNIA

FOR

U.S.D.A. FOREST SERVICE

P.O. BOX 11500, QUINCY, CA.

CREW: 2002
BILL SNOW
TERRI MASHEK

DRAWN BY: BILL SNOW

SHEET 20F3