

**VICINITY MAP**  
**NOT TO SCALE**

27	26	25
34	35	36
3	2	1
N		
N		

R9E R10E

① **RECORD:** 1" IRON PIPE MCBEEN LS 2702 (R6) **FOUND:** NOTHING FD AT CORNER POINT  
**SET:** 5/8" REBAR W/1.5" ALM CAP STAMPED LS 5623  
 FWBS: 1" IRON PIPE LS 2702 N3°57'43"E 8.62' (R6) NOT ACCEPTED

② **RECORD:** CALC POINT BY RCE 22836 (R5) **FOUND:** NOTHING (CORNER POINT FALLS CLOSE TO WILLIAMS CR.)  
**SET:** 5/8" REBAR W/1.5" ALM CAP STAMPED LS 5623  
 FWBS: N57°46'13"E, 7.04' 1/2" REBAR/W P.C. RCE 22836 (R5)

③ **RECORD:** 1" IRON PIPE X 18" TAGGED LS 2702 (R2) **FOUND:** NOTHING AT CORNER POINT  
**SET:** 5/8" REBAR W/1.5" ALM CAP STAMPED LS 5623  
 FWBS: 1" IRON PIPE TAGGED 2702 (R6) S84°D38'21"W, 5.40'  
 NOTE: THIS CORNER HAS BEEN OBLITERATED. THIS CORNER WAS MOVED TO MATCH THE EXISTING NORTH-SOUTH FENCE. PROBABLY THE OWNER OR THE FENCE BUILDER MOVED CORNER. VERY SUBSTANTIAL FENCE, R X R TIES POSTS BUT IT IS NOT MATCH TRUE CORNERS.  
*(SEE SHT. 3 FOR CORNER RESTORATION)*

④ **RECORD:** 1" IRON PIPE LS2702 (R2) **FOUND:** NOTHING AT CORNER POINT  
**SET:** 5/8" REBAR W/1.5" ALM CAP STAMPED LS 5623  
 FWBS: S89°04'47"W 0.26' FD 1" IRON PIPE LS 2702 (R2)


⑤ **RECORD:** NO RECORD CORNER **FOUND:** NOTHING AT CORNER POINT  
**SET:** 5/8" REBAR W/1.5" ALM CAP STAMPED LS 5623

⑥ **RECORD:** 1/2" STEEL PIN RCE 11173 (R3) **FOUND:** NOTHING AT CORNER POINT  
**SET:** 5/8" REBAR W/1.5" ALM CAP STAMPED LS 5623  
 FWBS: S89°23'10"W 0.40' 1/2" STEEL PIN RCE 11173 (R3)

⑦ **RECORD:** 1/2" STEEL PIN STAMPED RCE 11173 (R3) **FOUND:** NOTHING AT CORNER POINT  
**SET:** 5/8" REBAR W/1.5" ALM CAP STAMPED LS 5623  
 FWBS: N89°23'10"E 5.40' 1/2" STEEL PIN SET BY (R3)  
 S89°23'10"W 251.12' 1/2" STEEL PIN SET BY (R3)  
*(SEE DETAIL B ON SHEET 3)*

⑧ **RECORD:** 1/2" STEEL PIN RCE 11173 (R3) **FOUND:** NOTHING AT CORNER POINT  
**SET:** 5/8" REBAR W/1.5" ALM CAP STAMPED LS 5623  
 FWBS: N87°03'34"E 4.83' 1/2"STEEL PIN SET BY (R3)

⑨ **RECORD:** 1/2"STEEL PIN & PLASTIC CAP STAMPED RCE 22836(R5) **FOUND:** NOTHING AT CORNER POINT  
**SET:** 5/8" REBAR W/1.5" ALM CAP STAMPED LS 5623  
 FWBS: S84°13'07"E, 4.90' A 1/2 REBAR W/PLASTIC CAP STAMPED RCE 22836 (R2) NOT ACCEPTED AS CORNER

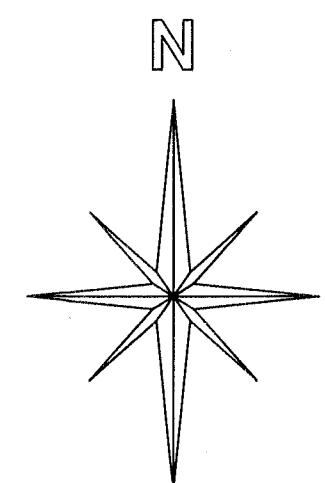

**1" = 100 FEET**

## BASIS OF BEARINGS (SEE SHEET 1)

## LEGEND

- SET 5/8" REBAR  
W/1.5" ALM CAP LS5623
- FOUND CORNER AS NOTED
- ▲ CALC. CORNER (13 RS 22)
- ⑩ CORNER NOTE
- P.C. PLASTIC CAP
- MKD MARKED
- ALM ALUMINUM
- WBS FROM WHICH BEARS
- FD FOUND
- R&M RECORD & MEASURED
- R1) 13 RS 22 (LS4753)
- R2) 3 PM 51 (LS2702)
- R3) 2 PM 131 (RCE11173)
- R4) 5 PM 43 (LS3202)
- R5) 8 PM 119 (RCE22836)
- R6) 2 RS 35 (LS2702)
- R7) 197 DR 703

## NOTE

Center-East-Northwest 1/64 (C-E-NW 1/64)  
Center North 1/16 (CN 1/16)  
North West 1/16 (NW 1/16)  
(BLM Manual of Instructions)

**SNOW LAND SURVEYING**  
**8736 DAMSELFY DR.**  
**RENO, NV. 89523**

**RECORD OF SURVEY**  
FOR  
**DENNIS & CINDY TAYLOR**  
DOC - 2017-0001017

**A PORTION OF THE EAST 1/2 OF THE NW 1/4 OF  
SECTION 35, T27N R9E, MDM  
PLUMAS COUNTY, CALIFORNIA**

W.G. SNOW DATE: JUNE 2018

SHEET 2 OF 4

CHINESE LITERATURE

16 RS 69